

REDUCTION OF LANDSLIDE VULNERABILITY BY MITIGATION MEASURES PROJECT

Site Specific Environmental and Social Management Plan

Site No. 167 Failed Slope between culvert No. 164/10 and 164/11 of Peradeniya Badulla - Chenkaladi Hwy (A5)

Badulla District

October 2024

Prepared for:



Prepared by:



National Building Research Organisation 99/1, Jawatta Rd | Colombo 05 Tel: 011-2588946, 011-2503431, 0112-2500354

Table of Content

1. Introduction	1
1.1 Project overview	1
1.2 Intended users	1
2. Description of the project	1
2.1 Name of the project	1
2.2 Location details	1
2.3 Topography and land ownership	2
2.4 Meteorology of the area	3
Landslide hazard incident details	3
3.1 Account of incident	3
3.2 Effects and consequences of landslide	3
3.3 Description of any remedial measures already undertaken to reduce the potential risk	3
3.4 Evacuations	3
3.5 Resettlement (progress)	3
4. Description of the area of the landslide/slope failure and areas adjacent to the landslide a level of risk	
4.1 Area of the landslide	6
4.2 Areas adjacent to the landslide	6
4.3 Current level of risk	6
5. Description of the works envisaged under the project	6
6. Brief description on the surrounding environment with special reference to sensitive elemate be affected by the project actions	
7. Identification of social and environmental impacts and risks related to the works	7
7.1 Positive impacts	7
7.2 Negative impacts	8
7.2.1 Hydrological and water Quality impacts	8
7.2.1.1 Impacts of the drainage pattern of the area	8
7.2.1.2 Water pollution and impacts on surface water quality	8
7.2.1.3 Erosional impacts and stream bed alterations	8
7.2.1.4 Open defecation and waterborne infections	8
7.2.1.5 Impacts on the downstream water uses	8
7.2.1.6 Impacts on ground water table and ground water quality	9
7.2.1.7 Impacts on water or wetlands	9
7.2.2 Environmental Impacts	9
7.2.2.1 Noise and vibration impacts	9
7.2.2.2 Air pollution impacts	9
7.2.2.3 Solid waste disposal issues	9

	7.2.2.4 Explosive hazards and hazardous materials	9
	7.2.3 Biological /Ecological Impacts	9
	7.2.3.1 Effects of important wildlife habitats	9
	7.2.3.2 Effects on Fauna & Flora	9
	7.2.4 Social and Economic Impacts	10
	7.2.4.1 Impacts on agriculture within the area to be remedied/ immediately to the site	10
	7.2.4.2 Cracks in the building due to vibration impacts	10
	7.2.4.3 Loosing access to land and future development activities	10
	7.2.4.4 Impacts on livelihood/ business and income activities	10
	7.2.4.5 Impacts on service provision (water supply, sewage, electricity)	10
	7.2.4.6 Effect due to loss of infrastructure and safety	10
	7.2.4.7 Work camps and lay-down site requirements	10
	7.2.4.8 Relations between workers and staff/ people living in the vicinity of the site and possibility of disputes	10
	7.2.4.9 Workers safety during construction	11
	7.2.4.10 Safety to the public from construction activities: High risk for commuters	11
	7.2.4.11 Impacts on transport infrastructure (especially temporary loss of road or rail access of traffic congestion)	
	7.2.4.12 Areas used for businesses, agriculture or other within the area to be remediated	11
	7.2.4.13 Areas used for businesses, agriculture or other immediately adjacent to the site	11
	7.2.4.14 Need for people to enter or cross the site	11
8.	Site Specific Risk Analysis	11
9.	Significant Environmental and Social Impacts	12
	9.1 Priority Health and Safety Issues. Specific H&S concerns that require measures that go beyo standard contractual requirements for contractors	
	9.2 Child labour & forced labour	12
10). Environmental Social Management Plan (ESMP)	12
	10.1 Resettlement action plan	12
	10.2Evacuation of people	12
	10.3Procedure for removal of damaged structures, facilities infrastructure (consent from owners remove the articles)	
	10.4 Requirement for compensation for loss of property /uses due to project actions	12
	10.5 Public awareness and education- needed for following areas	13
	10.6 Design based Environmental/ Social Management considerations	13
	10.7 Mitigation of impacts during the construction phase	14
	10.7.1Construction contractors' requirement to comply with environmental and social manage during the construction phase	
	10.7.2 Site Specific mitigation	15
	10.7.3 Monitoring requirements specific to the site	18
11	. Labour management	19
12	2. Preventive measures for COVID-19 that was issued by Sri Lankan national health authority	19

13. Public and Stakeholder Consultations -the public consultations that have been and/or will be held.	. 19
13.1 Public Consultations	. 19
13.2 Stakeholders involved in the consultations any recommendations or agreements reached in the consultations (Refer annexure II)	
14. Clearances, no objection, consent and approvals required for the implementation of the project	. 19
14.1 Project implementation	. 20
14.2 Approval from the state lands owners relevant to the project	. 20
14.3 Consent/ no objection/ legally bound agreement from the private land ownerships	. 20
15. Grievance redress mechanism for this site	. 21
16. Information disclosure	. 21

List of Annexes

Annexure I: Images of the site condition and the consultation	i
Annexure II: Report on the Stakeholder Consultation: Badulla District	i
Annexure III: Proposed procedure for obtaining approvals from state land owners and environ agencies.	mental
Annexure IV: Study team	
Annexure: List of references.	
Amexic. List of references	11
L : . 4 . C T :	
List of Figures	
Figure 1:Road map showing the accessibility to the site	
Figure 2: Google image of the proposed landslide mitigation site, the surrounding environment	tal features
and service infrastructure	2
Figure 3: Google image, cross sections, land use and risk elements of the location	5
Figure 4a: Upslope area	
Figure 4b:Downslope area	
Figure 4c: Subsidized land in down slope	
Figure 4d: Subsidized and cracked land of Mr Aron	
Figure 4e: Mr Aron's risk house in down slope	
Figure 4f: Mr Sanath's risk house in upslope	7
List of Tables	
Table 1: Negative impacts and their level of significance	8
Table 3: Design stage Environmental & Social considerations	13
Table 4: Contractor requirement to comply with ES & HS	14
Table 5: Site specific ES & HS mitigation measures	16
Table 6: Environmental and Social monitoring plan; construction phase	
Table 7: Clearances, no objection, consent and approvals	
Table 8: Tentative timeline for getting approvals	
Table 9: Proposed scheme of information disclosure	
Table 10: Level of information gathered through consulting institutions	22

Abbreviations

AIIB Asian Infrastructure Investment Bank

CEA Central Environmental Authority

DFC Department of Forest Conservation

DS Divisional Secretary

DWLC Department of Wild Life Conservation

EH & S Environmental Health & Social

E&SU of PMU Environmental & Social Unit of Project Management Unit

ESMF Environmental and Social Management Framework

SSE&SMP Site Specific Environmental and Social Management Plan

ESMP Environmental and Social Management Plan

GN Grama Niladhari

GOSL Government of Sri Lanka

GSMB Geological Surveys & Mines Bureau

NBRO National Building Research Organisation
PRDA Provincial Road Development Authority

RHS Right Hand Side
LHS Left Hand Side

1. Introduction

1.1 Project overview

The Government of Sri Lanka has received a loan from the Asian Infrastructure Investment Bank (AIIB) for mitigating/rectifying unstable slopes in high-risk areas especially in 13 districts of 06 provinces of the country under the Reduction of Landslide Vulnerability by Mitigation Measures Project (RLVMMP). The project requires to be implemented in accordance with environmental and social safeguards and mandates of the AIIB and that of Sri Lanka. Considering the nature of project actions and its implementation, an Environmental and Social Management Framework (ESMF) has been prepared as required by the AIIB environmental and social safeguard policy.

The purpose of the Environmental and Social Management Framework (ESMF) is to provide a guide for application of AIIB safeguards and national environmental and social mandates during the implementation of project actions. The project implementing agency (NBRO) is expected to ensure implementation of environmental and social management plans prepared under the ESMF during all phases of project implementation so that the impacts on the environment and community are minimum.

During the scoping exercise it was revealed that the environmental & social setting, and health & safety conditions are more site specific, and require to be addressed specific to site conditions. Therefore, the ESMF has recommended site specific environmental and social assessments followed by Site Specific Environmental and Social Management Plans (SSE&SMP) for each site. The SSE&SMP gives planning, design, construction and operation phase environmental, social, and health & safety management measures to be considered in the project Implementation.

This is the site specific environmental and social management plan for **Failed slope between culvert No. 164/10 and 164/11 of Peradeniya - Badulla - Chenkaladi Hwy (A5)** landslide mitigation site. This plan has been prepared by an in-depth environmental and social assessment to:

- i. Identify sensitive environmental and social elements in the project influence area
- ii. Identify significant environmental and social impacts due to project actions
- iii. Propose mitigation measures
- iv. Decide appropriate environmental and social monitoring requirements specific to this project
- v. Study relevant environmental regulations and procedures to be followed during project implementation specific to the site

1.2 Intended users

The document provides an in-depth insight into site-specific environmental and social issues associated with the proposed project and the mitigation measures and intends to be used by the landslide mitigation design team, the PMU and the contractor in the implementation of the Environmental and Social Management component of the project. The SSE&SMP is published in on the project website (https://rlvmmp.lk/) and can be viewed by wide range of interested parties (public, stakeholder organizations) can be utilized by the contractors for the project and will form the basis of site-specific management plans that will be prepared by the contractors as part of their Site Specific Environmental and Social Management Action Plans (SSE-SMAP) prior to commencing works.

2. Description of the project

2.1 Name of the project

Rectification of Site No. 167 Badulla District, for Failed slope between culvert No. 164/10 and 164/11 of Peradeniya - Badulla - Chenkaladi Hwy (A5) between Lunugala town and Bibila Town

2.2 Location details

The proposed mitigation site falls under Alakolagala GN division of Lunugala DS division, Badulla District, Uva Province.

GPS references of the site - 7.057796°N and 81.205076°E

Nearest town and accessibility to the site – Lunugala

Lunugala town is about 2.9 km from the site. The site can be accessed via Peradeniya - Badulla - Chenkaladi Hwy (A5) (Ref. fig. 1)

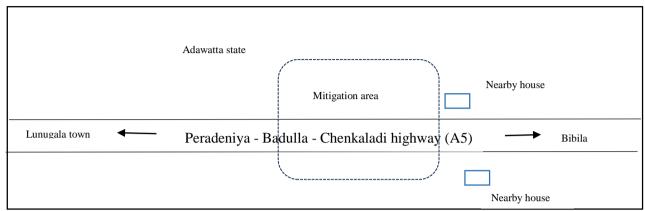


Figure 1: Road map showing the accessibility to the site

2.3 Topography and land ownership

The proposed mitigation site is located between culvert No.164/10 and 164/11 along Lunugala to Bibila Road. The failed slope section is located in the sloppy terrain of Adawatta Estate where the natural slope has been cut for the road construction. The slope failure has emerged from the upslope of the road including the road section and the reservation area. The elevation of the area is nearly 759 m. The extent of the site proposed to be mitigated is about 866 m². The land ownership of the upslope land is Adawatta Estate and the road reservation is owned by Road Development Authority. The downslope section is owned by private landowners.

Refer figure 2, Google image of the proposed landslide mitigation site, the surrounding environmental features and service infrastructure



Figure 2: Google image of the proposed landslide mitigation site, the surrounding environmental features and service infrastructure.

2.4 Meteorology of the area

Annual average rainfall – 391.96 mm Annual average temperature – 18.06 – 26.89 °C (Source: weatherandclimate.com)

3. Landslide hazard incident details

3.1 Account of incident

Slope failures in this road section were reported several times with the heavy rainfall. A falling of large rock and soil mass on the road blocking the road was reported in December 2023. Further, the downslope cultivated land was subsidized and cracks were formed. According to the information of the nearby people, a water channel flowing to road from the upslope is noticed with the heavy rainfall. slope failure *Refer Fig 3: cross sections, land use and risk elements of the location*.

3.2 Effects and consequences of landslide

The failed soil mass accumulated on the road section and disturbed the access to Bibila and Passara area and the vehicle transportation. No any causalities, injuries or damages to vehicles and to nearby houses and the infrastructure were reported due to the incident.

3.3 Description of any remedial measures already undertaken to reduce the potential risk

Any remedial measure has not been taken to reduce the potential risk

3.4 Evacuations

There are no risk houses identified which need to be evacuated.

3.5 Resettlement (progress)

There is no requirement of project-based resettlement or relocation as there are no risk houses.

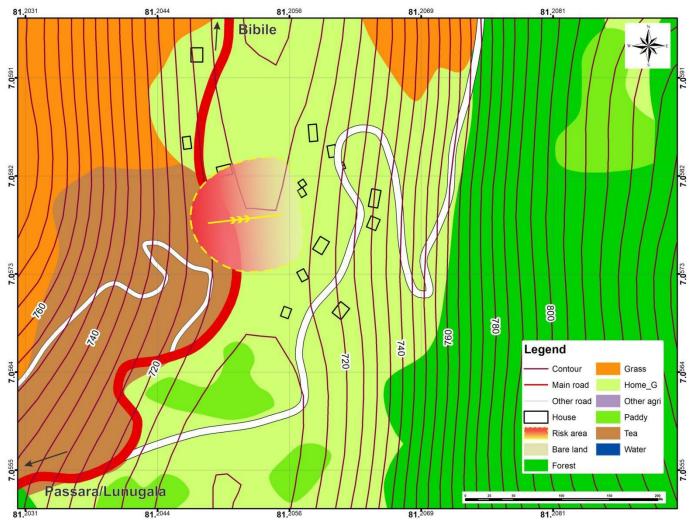


Figure 3: Google image, cross sections, land use and risk elements of the location

4. Description of the area of the landslide/slope failure and areas adjacent to the landslide and current level of risk

4.1 Area of the landslide

The area of the slope failure is located in an area where the slope had been cut to provide space to build the Bibila Passara (A5) Road between culvert No. 164/10 and 164/11. The upslope area is dominated by tea plantations owned by the Adawatta Estate. The downslope area of the road is consisting with the settlements with home gardens. Tea, Pepper, Palmyra, Jack, Mango, Arica-nut are the dominant tree species in the home gardens. This road is the only access road to Passara from Bibila area that provides the facilities and services to the public. There are no occupied houses directly downslope of the failed slope. Even now there are impinging loose weathered rock and fractured pieces of rocks posing high risk on the commuters.

4.2 Areas adjacent to the landslide

The adjacent upslope section contains mostly tea plantations owned by Adawatta Estate. Downslope area is consisting with homesteads and thick vegetation cover. There are many historical, famous and tourist attractive places around the unstable area. Both local and foreign tourists visit these places through this main road.

Refer Fig 4: Google image, cross sections, land use, risk elements and the photographs of special features of the location

4.3 Current level of risk

If the site is not rectified to prevent future failures, instability will be activated with the upcoming rains and the soil masses with rocks of the collapsed slope would disturb all functions of vehicle transportation between Bibila and Passara. The commuters, pedestrians, tourists, residents of the houses, workers of the neighboring tea plantations, and their livelihood activities would be at risk due to this unstable slope section. Also, the tea plucking activities and collecting tea leaves would be difficult and risky due to the unstable slope. Also, during future failures, it would limit the continuous functions of the road between Bibila and Passara as this is the main access way to Badulla, the obstruction of accessibility may pose a significant impact on lifeline facilities, services, and related economic activities including the transactions.

5. Description of the works envisaged under the project

Based on preliminary investigations, NBRO has carried out detailed investigations and design of suitable rectification measures to minimize the risk posed by this unstable slope section to ensure the safety of the commuters and the continued and uninterrupted function of this main road. The proposed activities include

- Earthworks including excavation and removal of soil mass
- Reshaping of upslope area
- Downslope crack sealing
- Gabian wall
- Turfing

6. Brief description on the surrounding environment with special reference to sensitive elements that may be affected by the project actions

The elements and services at risk during the project implementation are;

- i. Lunugala and Bibila Road between culvert No. 164/10 and 164/11
- ii. Commuters and pedestrians
- iii. Houses and their residents of the downslope
- iv. Tea cultivation and harvesting activities of Adawatta Estate
- v. Current services, economic and tourism activities of the area

(Ref. Fig.4 Sensitive elements that may be affected by the project actions)



Figure 4a: Upslope area



Figure 4b: Downslope area



Figure 4c: Subsidized land at the down slope



Figure 4d: Subsidized and cracked land of Mr Aron Sugathapala



Figure 4e: House at the down slope (the owner Mr. Aron)



Figure 4f: House at the upslope (owner Mr Sanath)

Figure 4: Sensitive elements that may be affected by the project actions

7. Identification of social and environmental impacts and risks related to the work

7.1 Positive impacts

• The objective of this project is to ensure that further occurrence of slope failure will be prevented to an acceptable level for the tea plantation land section, downslope settlement area and the road section. The Badulla area is considered by many to be one of the most scenic areas in Sri Lanka. This area has population centers such as Ella and tourist destinations such as Nine Arch Bridge. This road passes through the tea estates, pine forests, waterfalls, bridges etc. The

proposed project will significantly enhance safety of the road for commuters, tourists and pedestrians during rainy season and will allow keeping the road open throughout the year. The remediation may secure the cost of road rehabilitation from future slope failures and road damages in the area.

- Tourism activities and other life line activities of people in the area will be benefited largely by this mitigation.
- Main income of the occupants in the area is from tea plucking in Adawatta area and small-scale
 tea and pepper cultivation at the downslope slope area. Hence the project will enhance the
 cultivation of tea and there by household economic activities of tea puckers of the estate will
 be benefited.

7.2 Negative impacts

The mitigation works are generally confined to already failed land area. Therefore, negative impacts are much localized and also limited to construction period.

Table 1: Negative impacts and their level of significance

Impacts during the construction period	Level of Significance
7.2.1 Hydrological and water quality impacts	
7.2.1.1 Impacts of the drainage pattern of the area	
Disruption to existing surface and sub-surface drainage patterns in the area is envisaged with the project implementation. The mitigation works on this site will focus on drainage improvement. Therefore, during the rainy season heavy flow of water is expected to be generated and would be accumulated between the road and the slope. The water inundation of the existing drainage may be expected. An increase of water through the unstable slope may intensify the risk of slope failures of the unstable section.	Highly Significant
7.2.1.2 Water pollution and impacts on surface water quality	
During the slope excavation, the removal of debris can generate high sediment-laden runoff there could be a possibility that contaminated runoff may pollute the water within the stream flowing in the affected area. Improper disposal of oils and other harmful substances/contaminants from machinery, leakages from temporary storage tanks, solid waste, and wastewater disposal/dumping could occur causing adverse impacts on the quality of the water. However, during the rainy season, the rainwater running through the disturbed slope tends to pick up sediment, oil, and other pollutants generated during construction. As there is no stream nearby, the water pollution and impacts on surface water quality are considered insignificant.	Insignificant
7.2.1.3 Erosional impacts and stream bed alterations	
The project activities will open the slope for surface erosion during the construction phase. The existing surface and sub-surface drainage pattern in the area will be disrupted during the construction phase. The erosional impacts are not significant due to nonavailability of a stream in close proximity to the mitigation area.	Insignificant
7.2.1.4 Open defecation and waterborne infections	
As the site is located close to thick vegetation cover and tea plantations, the possibility of the open defecation is high. Faecal contamination of water of the runoff flow will be expected during construction due to open defecation of the contractor's workforce as the area consists of thick vegetation cover.	Significant
7.2.1.5 Impacts on the downstream water uses	
The construction activities will be carried out on slopes with exposed and loose soil, therefore, the slope will be prone to erosion during land clearing and land reshaping phase. This may increase the sediment load during rains and flow to the road, since there are no properly made drainage systems this may cause nuisance to pedestrians.	Insignificant

7.2.1.6 Impacts on ground water table and ground water quality	
Addition or mixing of construction materials including cements, grout materials with subsurface water flows will cause temporary water quality degradation and accumulation of unwanted substances. During the construction period, the hazardous waste from chemical substances, waste water from the construction activities and discharge of waste matter from onsite septic systems would cause adverse impacts on the ground water quality as the water of the natural stream may use by the residents. Due to the mitigatory activities carried out in the slope area, the ground water quality and spring water quality will be impacted or there will be a possibility for the ground water table draw down.	Significant
7.2.1.7 Impacts on water or wetlands	
Improper disposal of oils and other harmful substances/contaminants from machinery, leakages from temporary storage tanks, solid waste and wastewater disposal/dumping from workers' sites could occur causing adverse impacts on quality of the water.	Significant
7.2.2 Environmental Impacts	
7.2.2.1 Noise and vibration impacts	
Noise and vibration are expected from construction equipment. The pedestrians and commuters on roads will also be affected by noise and vibration. The commuters on the road and the residents of the downslope houses will be exposed to high noise during heavy noise-generating activities, such as operating loading, and unloading of materials, and movement of machinery in addition to the above-mentioned construction works.	Highly Significant
7.2.2.2 Air pollution impacts	
Construction activities that contribute to air pollution include land clearing, operation of diesel engines, demolition, and burning. Operating vehicles at high speed under dry weather conditions can increase such pollution. Improper handling and transferring of materials can also generate dust. Improper storage of materials can potentially generate dust if not properly covered. During construction, it generates high levels of dust typically from concrete, cement, wood, stone, and silica. The road is used heavily for vehicles moving (buses, bicycles, lorries, trucks, tippers, three wheels). The air pollution may have a significant impact on the commuters and pedestrians. The air pollution impacts from the construction are locally significant during dry periods for commuters, and nearby residents.	Highly Significant
7.2.2.3 Solid waste disposal issues	
Haphazard disposal of solid waste; various types of waste such as litter, food waste, and construction waste will be generated and may be stored or disposed of on-site. The littering and haphazard storage and disposal of solid waste in and around the site will create inconveniences to commuters, pedestrians, shop owners, and workers of the tea estate. It can block the drainage to make breeding grounds for water-borne diseases. Waste can pollute the soil, and leave various environmental impacts if a proper disposal mechanism is not in place during the construction period.	Highly Significant
7.2.2.4 Explosive hazards and hazardous materials	
Since the affected area has not observed the large rock boulders, explosives may not be used. If the rock blasting is envisaged, it may pose a risk due to unsafe use. If these operations are to be done on affected slopes the risk of improper use of explosives and accidents from rock fragments are significant. The impact is considered insignificant because there are no large rock boulders can be seen at the upslope.	Insignificant
7.2.3 Biological /Ecological Impacts	
7.2.3.1 Effects of Important Wildlife Habitats	
There are no forested/ wild-life reservation areas within the project influence area with high biodiversity.	Insignificant
7.2.3.2 Effects on Fauna & Flora	
The trees found in the area are not endemic, threatened, and identified in the red list of IUCN. There are patches of tea bushes of the Adwatta Estata at the failed upslope that	

may require to be removed for mitigation works. However, the impacts on these terrestrial ecosystems are localized as many project actions will be taking place on already failed or disturbed slopes.	Significant
There are household-base tea and pepper cultivation at the downslope and they may need uprooted for construction and also for making the access for material transportation.	Significant .
7.2.4 Social and Economic Impacts	I
7.2.4.1 Impacts on agriculture within the area to be remedied/ immediately	
at the site	Highly
There are small-scale household-based tea and pepper cultivation within the downslope area to be remedied and a large tea estate is located within the unstable upslope area. During the construction period, this land use pattern may be affected.	Significant
7.2.4.2 Cracks in the building due to vibration impacts	
The unstable land is located adjacent to a road. Vibrations can create cracks in the road too. Houses are located within the close proximity of the proposed mitigation site. Therefore, vibration impact on the upslope and down slope mitigation areas are significant. During the construction heavy machinery will be used and the vibration can widen the cracks which is in downslope lands and may create new ones.	Highly Significant
7.2.4.3 Loosing access to land and future development activities	
The land where the project activities are envisaged belongs to Adawatta Estate and the road reservation of RDA. The mitigation works will be concentrated on both upslope and down slope of the road. This area is a mainly tea cultivated land, there will be some impacts to the land owner with regard to loosing access to the land (during construction) and loss to valuable use of the tea cultivation. In contrary, remediation works in the upslope will increase the stability of the boundary and protect the land from future failures.	Highly Significant
7.2.4.4 Impacts on livelihood/ business and income activities	
The tea cultivation immediately adjacent to the unstable land would be affected during the construction period. The small-scale tea and pepper cultivation are the main income source of the downslope families, therefore it would be highly impacted during the construction period. This would affect the income of the community.	Highly Significant
7.2.4.5 Impacts on service provision (water supply, sewage, electricity)	In alonder on t
There are no service provision facilities in the mitigated area and associated areas that are affected by project actions.	Insignificant
7.2.4.6 Effect due to loss of infrastructure and safety	
During construction phase the main road from Bibila to Passara road will be obstructed by frequently moving machinery, loaders, trucks etc. as the access road is very narrow. Therefore, most of the heavy machinery, trucks and loaders can obstruct the vehicle transportation, pedestrian passage and cause traffic during peak times.	Highly Significant
7.2.4.7 Work camps and lay-down site requirements	
The camps site will be selected in the neighbourhood of the community. If proper camp management is not in place, it may result in several labour issues, social issues with community, conflicts for shared resources with the community, nuisances, and management of waste etc. If temporary camps are built in the close proximity of the site, management of solid waste and sewage will be an issue.	Significant
7.2.4.8 Relations between workers and staff/ people living in the vicinity of the site and possibility of disputes	
The construction workers at this site will be from different social backgrounds and from different geographical areas often under poverty. Usually, they are with poor educational and social background. Such communities may have a wide range of social issues to cause dis-stress on the neighbouring community and the workers of the project. Although the workers who would engage in such issues will be rare, even few possibilities cannot be ignored.	Highly Significant

7.2.4.9 Workers safety during construction	
The workers may be exposed to risk of falling. Fatal injuries may occur if the slope fails. The risk of slope failure is aggravated during the rainy season. This risk is highly significant. Risk of hazard from vehicle and construction machinery accidents is highly significant at this site. Contractor may engage underage workers (children) for construction work, which is risky and can result in serious accidents and injuries.	Highly Significant
7.2.4.10 Safety to the public from construction activities: High risk for	
commuters During the construction phase, the road will be obstructed by the frequently moving machinery, loaders, trucks, etc. As most of the mitigation works are to be carried out in limited space on slopes the heavy machinery, the trucks and loaders etc. can obstruct the commuter /pedestrian passage and may pose a high risk to their life. There is a risk of falling loose rocks on the road during excavations and the removal of rock poses a risk to commuters.	Highly Significant
The same risk at a high level will be there for the workers of the tea estate located in upslope and downslope as they will be exposed to a longer duration of this risk during the construction phase. Therefore, the risk to them is highly significant.	
7.2.4.11 Impacts on transport infrastructure (especially temporary loss of	
road or rail access, risks of traffic congestion)	Highly
The traffic due to full/partial road closure may obstruct the smooth flow of vehicles during the weekdays, during office hours, during school times, on holy days, seasons of pilgrimage. This will cause nuisance to pedestrians and commuters	Significant
7.2.4.12 Areas used for businesses, agriculture or other within the area to be	
remediated There is tea cultivation in the upslope and downslope within the area to be remediated would be impacted due to the construction activities.	Highly Significant
7.2.4.13 Areas used for businesses, agriculture or other immediately adjacent	
to the site There is tea cultivation in the upslope area immediately adjacent to the site owned by the Adawatta estate. They also would be impacted but the impact will be locally significant only for construction period.	Highly Significant
The small-scale tea and pepper cultivation are the main income source of the downslope families, therefore it would be highly impacted during the construction period. This would affect the income of the community.	
7.2.4.14 Need for people to enter or cross the site	
Excavation machinery, loaders, trucks etc. will be used in the area used to access in to the unstable slope area. There is no special need for commuters and neighbouring community to enter the site for other purposes. Construction may use materials such as metal aggregates, steel etc. which can be injurious under improper storage and handling. However, unauthorized entry of ordinary people may occur due to intentional or unintentional purposes and they may be at risk due to operating machinery, vehicles, electricity, and may be blasting materials.	Highly Significant

8. Site Specific Risk Analysis

Table 2: Site specific risk analysis

Risk	Affected group	Risk level
Facing accidents when working close to the road	Workers	Very high
2. Transporting materials and machinery	Workers/ Commuters/	Very high
	Residents	

3. Throw out disposals (litter, bottles, and food) to the construction site and nearby area	Workers Commuters/ Residents	Very high
4. Facing accidents during construction at night time	Workers	Very high
5. Accidents from the construction activities and materials placed close to the road	Commuters/ Residents	Very high
6. Injuries due to rock particles due to explosions/ blasting	Workers/ Commuters/ Residents	Very High
7. Rockfall from the unstable area	Workers/Commuters/ Residents	High
8. Work with electrified supply lines	Workers	High
9. Site Working – Working in poor visibility	Workers	High
10. Lone Working	Workers	High
11. Emergency evacuation	Workers/Commuters/ Residents	High
12. Extreme weather conditions (wind, rain etc.)	Workers	High

9. Significant Environmental and Social Impacts

Environmental, social impacts or risks that will require special attention on the part of NBRO.

9.1 Priority Health and Safety Issues. Specific H&S concerns that require measures that go beyond the standard contractual requirements for contractors

The health and safety issues pertinent to this site is significant as the workers have to work on an unstable slope with a risk of falling. Such common E & HS issues have been discussed in the **ESMF**. Worker safety requirement in the construction site is more detailed under 2003 5: Safety equipment and clothing in the section 2003: Working conditions and community health and safety in the Bidding document.

9.2 Child labour & forced labour

Child labor & Forced labor is detailed under 2003.3 under section 2003: Working conditions and community health and safety in the Bidding document.

10. Environmental Social Management Plan (ESMP)

Measures to manage and or mitigate the impacts and risk. Especially the significant impacts and risks identified in sections 7 & 8. This section will include the specific recommendations and requirements of the ESMP for the design stage, construction phase and maintenance operation phase.

10.1 Resettlement action plan

There is no project-based resettlement on this site.

10.2Evacuation of people

Project based evacuations are not required for this site.

10.3Procedure for removal of damaged structures, facilities infrastructure (consent from owners to remove the articles)

This risk may not be triggered in this site.

10.4 Requirement for compensation for loss of property /uses due to project actions

This risk may not be triggered in this site.

10.5 Public awareness and education- needed for following areas

- i. Programs to inform and educate people in the vicinity and workers of the plantation estate, about the risks posed by unstable land section
- ii. Requirement for special awareness for nearby residents, commuters and the people passing through the area using the road with potentially high-risk during construction phase and early warning.

10.6 Design based Environmental/ Social Management considerations

The site is located in an aesthetically beautiful, environmentally sensitive natural environment in the rural setup. Hence, following environmentally and socially significant design considerations are recommended.

Table 3: Design stage Environmental & Social considerations

Design feature	Recommended level of consideration for this site
i. Natural resource management and resource optimized designs Project specific designs should be considered to eliminate mass clearing of vegetation and minimum number of removals of grown tree species. Sufficient emphasis should be made to consider conservation of trees if important tree species are found.	Very High
ii. Site Planning During site planning it is necessary to be cautious on possible re-activation of landslide with rock fall. Also, the site is located in a very limited space of a slope with a road. The vehicle parking sites, material storage and temporary shelters etc. should not be installed in the danger zones of the slides. It is very necessary to keep trained flagman or safety officer during the construction period and proper communication between contractor's workforce and the other responsible officials should be maintained.	Very High
iii. Habitat connectivity and animal trails If large fractions of vegetation are required to be cleared in ecologically fragile habitats as for permanent structures or for access, or if deep drains etc. are to be made the designs should include habitat connectivity features, animal trails and vegetation strips and etc. even if the impacts are localized.	High
iv. Conservation of water resources If involves extraction of water both surface and sub-surface. The water extracted is in relatively good quality. In a well thought design this extracted water can be conveyed in such a manner that the water can be accessed by wild fauna as well as the neighboring communities for bathing and other domestic purposes.	High
v. Interruption to water supplies	
If the water in the mitigated slope is used as a source for individual or community water supply, the chance the water source can be affected by the mitigation work is high due to water table draw down. In such instances the design should include alternative source of water for the community (temporary/or permanent).	Very High
vi. Aesthetically compatible design considerations	Vorus III ob
The designs in aesthetically sensitive environments should consider structures that blend with natural environment to keep the visual pollution to minimum. As the tourism industry is one of the major economic growth points for the project area, greening could be used in construction activities to develop the area as a tourist attraction. Service of landscape architect may be important for the design of suitable mitigation structures.	Very High

Consideration of anomaly and I features	
vii. Consideration of green environmental features As many of the mitigatory works are carried out in ecologically sensitive habitats, it is recommended to consider green environmental designs as much as possible in the designs e.g.: use of local vegetation species for erosion control, combination of plants to sustain species diversity in the environment, avoiding inclusion of potentially invasive species & etc.	Very High
viii. Conservation of social and cultural features	
The local cultures and heritages are strengthened by their close connections to the natural environment that sustains them. Therefore, the project actions should be carried out considering local culture and social aspects, providing opportunities to reinforce them during the project actions.	Low
ix. Workers/ commuters and community safety	
Due to the close proximity to the roads people may face accidents specially the workforce during the construction phase. Unauthorized entry and ignorance may cause severe accidents around the site. Activation of slides or ground subsidence may occur during construction phase and may pose threat to workers of RDA, passengers and commuters. Therefore, design-based safety consideration such as beams, safety nets etc. should be considered.	Very high
x. Erosion control structures	
In drainage management, water is extracted and conveyed to nearby streams often through culverts. During rainy season the flow in these drainage structures can be significantly high and this may cause stream bed erosion. Hence the design should adequately consider flow speed breakers to reduce erosive flows entering natural streams. This should be an inclusive part of the design if there are streams and culverts in the proximity of the mitigation site.	High
xi. Low post maintenance and operation designs	
The mitigation should consider passive techniques such as gravity drains for drainage management. Correct pipe diameters, pore diameters and laying angles should be considered to avoid clogging of drains. Low maintenance structures and designs such as designs to withstand erosive forces, sediment trapping systems etch should be considered if drain water is expected be directed to natural streams. The materials used for structures and should be chosen carefully so as to withstand weather conditions with high durability. Designs should specially consider corrosion prevention techniques if steel structures are used.	Very High

10.7 Mitigation of impacts during the construction phase

10.7.1 Construction contractors' requirement to comply with environmental and social management during the construction phase

Measures to manage and to mitigate the environmental and social impacts are generally common to all landslide mitigation sites. Such impacts are largely attributed to activities in the construction phase. The mitigation of impacts therefore becomes an obligation of construction contractor. NBRO has prepared a comprehensive document on "contractors' requirement to comply with Environmental and Social Health and Safety (ES & HS) management during the construction phase" to be included in construction contractors' bid document. The main sections are summarized below (Table 4) indicating the degree of relevancy for this site. For details ESMP for construction contractors should be referred.

Table 4: Contractor requirement to comply with ES & HS

Reference No. as per construction contractor's obligation to ESMP	Item	Relevant to the project
	and Social Monitoring	
2002.2 1)	Storage on site	Highly Relevant (road reservation)

2002.2 2)	Noise and Vibration	Highly relevant (commuters,
,		pedestrians)
2002.2 3)	Cracks and damages to the buildings	Relevant
2002.2 4)	Disposal of waste	Relevant
2002.2 5)	Disposal of refuse	Highly relevant (road reservation)
2002.2 6)	Dust control	Highly Relevant (commuters,
		pedestrians)
2002.2 7)	Transport of Construction materials and waste	Relevant
2002.2 8)	Water	Relevant
2002.2 9)	Flora and Fauna	Relevant
2002.2 10)	Physical and cultural resources	Not relevant
2002.2 11)	Soil Erosion	Relevant
2002.2 12)	Soil Contamination	Relevant
2002.2 13)	Borrowing Earth	Relevant
2002.2 14)	Quarry Operations	Not relevant
2002.2 15)	Maintenance vehicles and Machinery	Relevant
2002.2 16)	Disruption to public	Highly relevant (community nearby)
2002.2 17)	Utilities and roadside amenities	Highly relevant (road)
2002.2 18)	Visual environment enhancement	Highly relevant (Aesthetically sensitive
		road section)
2002-5.	Baseline surveys (air, water, noise, vibration,	Refer site specific monitoring plan
Environmental	crack surveys)	
Monitoring	Surveys during construction (air, water, noise, vibration, crack surveys)	Refer site specific monitoring plan
	Surveys during operation phase	Refer site specific monitoring plan
	Reporting and maintenance of records	Relevant
2003 Working Co.	nditions and Community Health and Safety	
2003.2	Safety organization and communication	Highly relevant (unsafe slope,
2003.2	surety organization and communication	commuters, heavy machinery)
2003.3	Child Labor and Forced Labor	Relevant
2003.4	Safety reports and notification of accidents	Highly relevant
2003.5	Safety Equipment and Clothing	Highly relevant
2003.6	Safety inspections	Highly relevant
2003.7	First Aid Facilities	Highly relevant
2003.8	Health and safety information and training	Highly relevant
2003.9	Plant equipment and qualified personnel	Relevant

Relevant: The section is relevant to the site as a common ESMP applicable to any site

Highly relevant: The contractor should pay special emphasis in the preparation of environmental method statements to ensure that the relevant ESMP is implemented specific to the site

Possibly relevant: This ESMP will be triggered if the site come across with relevant aspect during project implementation

Not relevant: The section may not be relevant to this site under disclosed conditions

Optional: require to be implement if needed only

Refer site specific monitoring plan: Contractor is obliged to carry out monitoring as specified in the site specific monitoring plan

Reference: Contractors Obligation for implementation of ESMP

10.7.2 Site Specific mitigation

Given below are the site-specific mitigation measures that the project is expected to implement during the construction period.

Table 5: Site specific ES & HS mitigation measures

Mitigation item	Project implementation phase	Responsibility
i. Minimize erosional impacts during construction	Site preparation &	Construction
It is recommended that mitigation works involved with site clearance, slope reshaping, removal of debris etc. are avoided during rainy season. Therefore, it is imperative that site works in upslope mitigation are carried out in the dry season and avoid such activities on upslope area in the wet season as much as possible. This should be considered in project planning stage. Silt traps should be introduced to cut down sediment laden runoff.	construction	Contractor
ii. Invasive species	Construction	Construction
Should be avoided in using vegetative erosion control structures. Native plants in the local environment should be chosen for vegetative control. The species used for vegetative control measures need approval from the Department of Wildlife Conservation & Department of Forest.		Contractor
iii. Impacts on transport infrastructure (especially temporary loss of road or rail access, risks of traffic	Construction	Construction
congestion) A good traffic control should be implemented in the construction stage. As there is a bend on the road adjacent to the site proper road safety measures should be included with warning signs and permanent trained watchmen, luminous sign boards indicating slope instability risk and road obstruction signs, night lamps etc. are strongly recommended at this site.		
iv. Priority Health and Safety Issues		DMI
As the workers in the site have to work in high risk conditions, it is imperative to implement recommendations given in section 2003 of contractors' obligation on ESMP under "working conditions and community health and safety". These recommendations should be followed carefully in a proper organization and safety monitoring system. i. Prepare a special Occupational Health and Safety Management Plan prior to commencement of construction activities ii. A good warning system and full-time watchmen is highly recommended for this site for both worker and commuter safety.	Construction	PMU Construction Contractor
 iii. Safety barriers and safety nets should be installed at places of risk to protect workers and commuters from boulder falling risk Adoption of standard worker safety methods iv. Provision of personal protective equipment (PPE) such as 		
safety boots, helmets, protective clothing goggle etc. v. Provision of training and awareness programs to employees		
vi. Conducting hazard analysis and plan/provide adequate mitigation measures for such hazards identified, prior to carrying out major construction activities		
vii. If the wasp nest is in the vicinity, it is mandatory to use Evacuation Centres for ensure of workers' safety viii. Additionally, work should be discontinued for sufficient		
time period during rainy period as working on unstable land will be highly risky in the rainy season		

ix. Throw out disposals (litter, bottles, and food) to the construction site from the commuters.	Site preparation & construction	Construction Contractor
Put up the safety sign boards prior to the construction site indicating people at work. The commuters should be aware about the construction activities through notices erected before reaching the proposed mitigation site.		
x. Injuries due to rock particles due to explosions/ blasting	Construction	Construction
Minimize all blasting activities during peak times and making awareness announcements through the blasting period. Establish an emergency accidents preparedness plan for their injuries due to rock particles due to explosions/ blasting.		Contractor
xi. Minimize erosional impacts during construction	Site preparation &	Construction
It is recommended that mitigation works involved with site clearance, slope reshaping, removal of debris etc. are avoided during rainy season. Therefore, it is imperative that site works in slope mitigation are carried out in the dry season and avoid such activities on slope area in the wet season as much as possible. This should be considered in project planning stage. Silt traps should be introduced to cut down sediment laden runoff.	construction	Contractor
xii. Disposal of construction waste	Site preparation &	Construction
The contractor should pay special attention with respect to disposal of construction waste. This site is located close to a main road in a rural landscape with a pleasing environment. Also, this main road is used by many tourists as Badulla is a main tourist attraction places in Sri Lanka. Stream is flowing from the upslope to the downslope of the site and water seepages are available in the area during rainy season. Therefore, such waste if generated should store properly without getting washed off and dispose according to approved procedures by the PMU. Construction waste should not dispose along the road or into the drainages.	construction	Contractor
xiii. Onsite sanitary facilities for the workers The contractor should prepare temporary sanitary facilities for the	Site preparation & construction	Construction Contractor
workforce within the site, to mitigate open defecation of the workers.		
xiv. Dust and aerosol control screens Dust particles generated during the construction period can influence the commuters, shop owners, customers and tourists. The commuters traveling in the Badulla main road specially tourists could be affected from generated dust particles. Special screens etc. should be used if heavy dust or aerosol generating activities are envisaged.	Site preparation & construction	Construction Contractor
xv. Water for construction	Construction	Constanting
Water for construction works should be obtained only from the approved sites.	Construction	Construction Contractor
xvi. Working hours	Construction	Construction
The construction activities should be restricted to day time only. Working after 6.p.m. is not recommended for any reason due to safety issues.		Contractor
xvii. Impact on service infrastructure	Construction	Construction
Telecommunication, electricity, water lines should be relocated before construction starts as per the approval of PMU.		Contractor
xviii. Need for people to enter or cross the site	Construction	Construction
Possible unauthorized access to the site should be avoided by awareness, warning signs and vigilance by the contractor's full-time watchmen.		Contractor
xix. During construction good housekeeping should be maintained to minimize visual pollution	Site preparation & construction	Construction Contractor

xx. Worker's code of conduct Possible disputes between the labor force and the commuters and	Construction	Construction Contractor
tourists should be prevented by maintaining the agreed code of conduct by the contractor.		
Possible disputes between workforce and commuters should be avoided especially when using shared resources such as common bathing and washing places etc.		
xxi. Snake bites, toxic ants management and emergency management by accidents	Construction	Construction Contractor
Proper emergency management system for snake bites and toxic insect attack (include awareness on snake bites, safety shoes while at		
work, first aid on a snake bite, hospitalization and admission to correct hospital where snake bite management facilities are available) should		
be introduced. Accidents are common in these kinds of sites. Proper emergency		
management unit for other accidents (first aids facilities, safety items,		
hospitalization facilities and transportation facilities) should be maintained for this site.		

10.7.3 Monitoring requirements specific to the site

Following monitoring plan is strongly emphasized during the construction phase specific to this site. In addition to this, monitoring procedure indicated in the contractors' obligation to ESMP should also be implemented by construction contractor. The contractor is expected to indicate in the bid the ESMP procedure to be implemented along with relevant proofs of his competency. The cost for ESMP will require to be indicated as a separate pay item. The environmental and social management method statement is expected to be submitted by the selected construction contractor and to be approved by the PMU unit.

Table 6: Environmental and Social monitoring plan; construction phase

Monito		Parameters Frequency			
requir	ement		• •		
i. Bas	seline	Water quality	-		
mor	nitoring	Pre-construction crack survey	-		
		Ground vibration	Once*		
		Air quality: particulate matter	Once*		
		Background noise measurement	Once*		
ii. Dur	ring struction	Water quality (Stream)	If noticeable water quality impairment due to sediment laden runoff		
		Crack survey for the risk buildings	If noticeable displacement is observed during construction **		
		Ground vibration	During operation of drilling machinery, boring works, or any works that generate ground vibrations*		
		Construction noise	Once a month during heavy noise generation times *		
		Air quality particulate matter	Once a month *		
iii. Veh Emi	nicular ission	All machinery/vehicles operational should hav applicable - should be checked by the site ES			
iv. Morager	nitoring ency	* A competent independent monitoring agency with registration of Central Environmental Authority for all parameters except crack surveys **Crack surveys should be conducted by competent agency acceptable to PMU			
v. Rep	orting		National Environmental (ambient water quality)		
_	uirements	regulations, no.01 of 2019			
		Pre-construction crack survey of the high-risk buildings-Professional report			

Ground vibration-as per the interim standards on vibration for the Machinery, Construction activities and Vehicular movements, CEA

Background noise measurement –Extraordinary Gazette No.924.1, May 23,1996, CEA **Air quality particulate matter-** The National Ambient Air Quality standards stipulated under the Extraordinary Gazette, No. 1562/22 August 15, 2008 -Central Environmental Authority of Sri Lanka.

11. Labour management

Sound worker-management relationships, treating workers in the project fairly and providing safe and healthy working conditions is required. Responsibility is lies with the PMU and the construction contractor.

The Objectives are;

- To promote safety and health at work.
- To promote the fair treatment, nondiscrimination and equal opportunity of project workers.
- To protect project workers, including vulnerable workers such as women, persons with disabilities, children and migrant workers, contracted workers, community workers and primary supply workers, as appropriate.
- To prevent the use of all forms of forced labor and child labor.
- To support the principles of freedom of association and collective bargaining of project workers in a manner consistent with national laws.
- To provide project workers with accessible means to raise workplace concerns.

12. Preventive measures for COVID-19 that was issued by Sri Lankan national health authority (this is applicable if Notification on Covid -19 epidemic/ endemic is issued by Health Authorities Sri Lanka)

COVID-19, the novel corona-virus infection has not been totally eradicated in the world. Therefore, to prevent/ control of the spread of infection also to prevent panic situations in the event of detecting a suspected case, all contractors are required to develop a COVID-19 Preparedness plan and need implementing in the site as per the "Health and Safety Guidelines for Sri Lankan Construction Sites to be adopted during COVID 19 outbreak" Guidelines given by Construction Industry Development Authority CIDA 29th April 2020.

13. Public and Stakeholder Consultations -the public consultations that have been and/or will be held

13.1 Public Consultations

During environmental and social assessment 2 houses at the downslope were visited by the study team and Mr, Aron, and the son of Mr Shantha, the owners of 2 houses at the downslope were consulted and made aware of the mitigation project and the funding mechanism. They stated that the mitigation works are appreciable and expressed their willingness to the project.

13.2 Stakeholders involved in the consultations any recommendations or agreements reached in the consultations (Refer Annexure II)

Mr. W.M. Surasena, Field Officer of Adawatta Estate was informed about the project works and got the clearances for the project.

14. Clearances, no objection, consent and approvals required for the implementation of the project

Table 7: Clearances, no objection, consent and approvals

Requirement / Approval / Institution	Relevance to the project
14.1 Project implementation	
Approval from the District Secretariat	The approvals will be required and the proposals need to be presented at the District Coordinating Committee, to which chief minister and stakeholder agencies in the district will also participate. The Officer of PMU will present the project, disclose the project details and various concerns including environmental and social issues will be discussed at this meeting. The issues arrived will be addressed in the ESMP, the decisions and recommendations taken up at this meeting will be considered in the ESMP.
Approval from the planning committee	The approval from the planning committee of the Lunugala pradeshiya Sabha.
14.2 Approval from the state lands ov	wners relevant to the project
Central Environmental Authority	Consent from District Central Environmental Authority is required as Badulla District is under the sensitive area under Soil Conservation Act 25 of 1951.
Department of Forest Department of Wildlife Conservation	As there is no forest reservations and wildlife habitats; Department of Forest and Department of Wildlife Conservation approvals are not needed
Geological Surveys and Mines Bureau	Approval will be obtained for extraction of materials, transportation and disposal of earth, rocks and mineral debris. (If necessary, only).
Lunugala Divisional Secretariat	Approvals from Lunugala Divisional Secretariat will be obtained for the disposal of waste and plant litter.
Ceylon Electricity Board	Approvals from regional office of Ceylon Electricity Board will be required for power supply for site operation.
National Plant Quarantine Service	Approval from Additional Director National Plant Quarantine Service Katunayake for Director General of Agriculture under the Plant Protect Act No. 35 of 1999 Plant or seed if needed for bio—Project Managed slope mitigation shall be imported into Sri Lanka under the authority and in accordance with the conditions, of a plant importation permit issued.
14.3 Consent/ no objection/ legally bo	ound agreement from the private land ownerships
Land owners (RDA, Adawatta Estate & Private landowners of downslope mitigation area	Signing a legally bound agreement between the land owner and the project implementing authority allowing no-objection to remove the structures, access the land, implement construction works, and engage in long-term maintenance works

The tentative timeline for getting approval is given in the table 7.

Table 7: Tentative timeline for getting approvals

Approvals		Month 1			Mor	Month 2		
	W1	W2	W3	W4	W1	W2	W3	W4
Project implementation								
Approval from the District Secretariat								
Submission of application								
Project briefing								
Respond to comments								
Approvals				_				
Approval from planning committee								
Submission of application								
Project briefing		_						
Respond to comments					L			
Approvals								
Approval from state land owners RDA								
Submission of application		l I	+					
Respond to comments		-		<u> </u>				
Approvals								
Other approvals								
GSMB		l						
Ministry of Defense (Depends on the requirement)								
Consent/ no objection from the land ownership								
(RDA and Adawatta Estate)								

15. Grievance redress mechanism for this site

The PMU ES officer is responsible for establishing the grievance redress mechanism for this site for impact communities. (Reference: Environmental and Social Management Framework for recommended procedure for establishment of grievance redress mechanism).

16. Information disclosure

It is the responsibility of the PMU to disclose the ES information to following agencies and organizations by indicated modes as a minimum as given in the following table.

Table 9: Proposed scheme of information disclosure

Information	Proposed agencies	Mode of information disclosure
i. Project plan (site	District CEA, District Secretariat,	Meetings, District coordination
details, design,	Divisional secretary, RDA, Other district	committee, submission of relevant
implementation	levels Agencies, NBRO district office,	report to sign agreements, approvals
arrangements)	AIIB	and consents.
ii. Environmental and	District CEA, AIIB,	Meetings, District Coordination
Social Management plan		Committee, submission of relevant
		report to sign agreements, approvals
		and consents
iii. Monitoring reports	District CEA, AIIB and relevant parties as	Progress meetings, special meetings,
(baseline and during	appropriate	submission of relevant reports
construction)		
iv. Site inspections for	District CEA, RDA, Divisional secretary,	Written and verbal communications,
environmental	Police, State Land Owners, Grama	submission of relevant reports
conformance workers	Niladhari, District Office NBRO, AIIB and	
health and safety	relevant parties as appropriate	
v. Decisions taken and	District CEA, RDA, Divisional secretary,	Meetings, submission of relevant
progress review meetings	Police, State Land Owners, Grama	reports
pertinent to ES matters	Niladhari, District Office NBRO, AIIB and	
	relevant parties as appropriate	


vi. Grievance redress	Relevant parties, AIIB	Meetings,	written	and	verbal
mechanism		communicat	tions		

Table 10: Level of information gathered through consulting institutions

Date	Institution	Person contacted for information
16/06/2024	Adawatta Estate	Mr. W.M. Surasena , Field Officer Adawatta Estate 0761895100
17/11/2024 (Through the phone)	Divisional Secretariat Office - Lunugala	Mr. R.M.D.S.B Rathnayaka 94-E, Alakolagala GN division 071-5709220
17.11.2024 (Through the phone)	RDA office Bibila	Mr. Dineth Wimaladharma Project engineer Badulla- Chenkaladi Road Improvement Project 076-9489993

Annexure I: Images of the site condition and the consultation



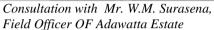



Consultation with the son of Mr. Shantha, the owner of a house at the downslope

Annexure II: Report on the Stakeholder Consultation: Badulla District

Institution	Name and	Concerns raised	
	designation of the contact officer		
Central Environmental Authority	Provincial Director, Central Environmental Authority Uwa Province.	 ✓ Under the Soil Conservation Act 25 of 1951 of National Resource Management Centre, Badulla District has been gazetted as a sensitive area. ✓ Under this gazette any development is not allowed irrespective of the magnitude of the project. ✓ In a disaster this is not needed. ✓ Landslide mitigation projects are not considered projects prescribed in the Gazette. ✓ The Basic Information Questionnaire (BIQ) is needed to fill for the project and submit the application ✓ As the proposed project (mitigation) intends to reduce the risk from landslide for an emergency action CEA approval is not needed considering the priority of the project. ✓ Before project commence a request indicating the mitigation sites need. ✓ If the project is carried out in a sensitive area, even not within a prescribed project, consideration of sensitive area will govern the process. 	
Road Development Authority	Chief Engineer	 ✓ This area is under the jurisdiction of Badulla District RDA office ✓ The RDA has no objection and states the mitigation is very much needed. ✓ Other concerns raised • A proper handing over of the project is required after the mitigation • RDA will do the maintenance after mitigation • It is emphasized that during the construction the contractor should use Personal Protective Equipment • At all times, the contractor shall provide safe and convenient passage for vehicles, pedestrians, and traffic safety measures, barricades, flagmen and for the night work, lights and illumination should be provided. ✓ It is also stated that Construction waste/ excavated materials should not be a nuisance to public/commuters 	

Annexure III: Proposed procedure for obtaining approvals from state land owners and environmental agencies.

1. Proposed procedure by RDA for approval for implementation of landslide mitigation projects in RDA reservation areas

i. The design to be accepted by the RDA: The project implementing agency should submit detailed design report to RDA with a formal request on nature of approvals required.

- PMU should prepare above documents and should submit the documents to RDA regional office.
- ii. RDA regional office will evaluate the proposal and may call for project briefing. The PMU should provide necessary briefing as appropriate
- iii. On the approval by RDA an agreement will be signed between RDA and Project implementing agency to access the site, erect structures, and implement mitigation works.
- iv. A condition that would include is
 - A proper handing over of the project is required after the mitigation
 - RDA will do the maintenance after mitigation
 - It is emphasized that during the construction the contractor should use Personal Protective Equipment
 - At all times, the contractor shall provide safe and convenient passage for vehicles, pedestrians, and traffic safety measures, barricades, flagmen and for the night work, lights and illumination should be provided.
 - Construction waste/ excavated materials should not be a nuisance to public/commuters

Annexure IV: Study team

Name	Designation	Position in the study
SAMS Dissanayake	Senior Scientist/ESSD/NBRO	Senior Environmental Scientist
Prabath Liyanaarachchi	Scientist/ ESSD/NBRO	Environmental scientist, GIS/ Demographic data collection /survey, Report preparation
Asanka Sanjaya	Field Assistant	Assistant - data collection for the SSESMP
Ranil Jayawardhana	Field Assistant	Assistant - data collection for the SSESMP

Annexure: List of references

- 1. Contractor's obligations for Generic Environmental and Social Management Plan- Sri Lanka Landslide Mitigation Project-AIIB
- 2. Environmental and Social Management Framework-Sri Lanka Landslide Mitigation Project AIIB
- 3. Resettlement Planning Framework- Sri Lanka Landslide Mitigation Project -AIIB
- 4. Felling Trees (Control) Act by Ministry of Agriculture, Rural Economic Affairs, Livestock Development, Irrigation and Fisheries and Aquatic Resources Development
- 5. Census and Statistical Report (2012), Department of Census and Statistics