



REDUCTION OF LANDSLIDE VULNERABILITY BY MITIGATION MEASURES PROJECT

Site Specific Environmental and Social Management Plan

Site No. 188
Unstable Rock fall /Landslide Locations
At Thummodara – Puwakkpitiya road (B426)

Colombo District

June 2025

Prepared for:



**ASIAN INFRASTRUCTURE
INVESTMENT BANK**

Prepared by:



National Building Research Organisation

99/1, Jawatta Rd | Colombo 05

Tel: 011-2588946, 011-2503431, 0112-2500354

Table of Content

1. Introduction.....	1
1.1 Project Overview	1
1.2 Intended users	1
2. Description of the project.....	1
2.1 Name of the project	1
2.2 Location details.....	2
2.3 Topography and Land Ownership	2
2.4 Meteorology of the area (Padukka)	4
3. Rock falls/ Landslides hazard incident details.....	4
3.1 Account of incident	4
3.2 Effects and consequences of Rock falls/ Landslides	4
3.3 Description of any remedial measures already undertaken to reduce the potential risk.....	4
3.4 Evacuations.....	5
3.5 Resettlement (progress)	5
4. Description of the area of the rock fall, areas adjacent to the rock fall and current level of risk.....	5
4.1 Area of the rock falls / slope failures.....	5
4.2 Areas adjacent to the rock falls / slope failures	7
4.3 Current level of risk.....	7
5. Description of the works envisaged under the project.....	7
6. Brief description on the surrounding environment with special reference to sensitive elements that may be affected by the project actions	8
7. Identification of social and environmental impacts and risks related to the works	11
7.1 Positive impacts.....	11
7.2 Negative impacts	11
7.2.1 Hydrological and water quality impacts.....	12
7.2.1.1 Impacts of the drainage pattern of the area	12
7.2.1.2 Water pollution and impacts on surface water quality	12
7.2.1.4 Open defecation and waterborne infections	12
7.2.1.5 Impacts on the downslope water users.....	12
7.2.1.6 Impacts on groundwater table and groundwater quality	12
7.2.1.7 Impacts on water or wetlands.....	12
7.2.2 Environmental Impacts	12
7.2.2.1 Noise and Vibration Impacts.....	13
7.2.2.2 Air pollution impacts	13
7.2.2.3 Solid Waste Disposal Issues	13
7.2.2.4 Explosive hazards and hazardous materials	13
7.2.3 Biological /Ecological Impacts	13

7.2.3.1 Effects of Important Wildlife Habitats.....	13
7.2.3.2 Effects on Fauna & Flora.....	13
7.2.4 Social and Economic Impacts	13
7.2.4.1 Impacts on agriculture within the area to be remedied/ immediately to the site.....	13
7.2.4.2 Cracks in the road/houses/shops due to vibration and blasting impacts	14
7.2.4.3 Loosing access to land and future development activities	14
7.2.4.4 Impacts on livelihood/ business and income activities	14
7.2.4.5 Impacts on service provision (water supply, sewage, electricity).....	14
7.2.4.6 Effect due to loss of infrastructure and safety.....	14
7.2.4.7 Work camps and lay-down site requirements	14
7.2.4.8 Relations between workers and people living in the vicinity of the site and possibility of disputes.....	14
7.2.4.9 Workers safety during construction	15
7.2.4.10 Safety to the public from construction activities: High risk for commuters/tourists	15
7.2.4.11 Impacts on transport infrastructure (especially temporary loss of road, risks of traffic congestion)	15
7.2.4.13 Need for people to enter or cross the site.....	15
8. Site Specific Risk Analysis.....	15
9. Significant Environmental and Social Impacts.....	16
9.1 Priority Health and Safety Issues. Specific H&S concerns that require measures that go beyond the standard contractual requirements for contractors.....	16
9.2 Child labour & forced labour.....	16
10. Environmental Social Management Plan (ESMP).....	16
10.1 Resettlement action plan.....	16
10.2Evacuation of people	16
10.3Procedure for removal of damaged structures, facilities infrastructure (consent from owners to remove the articles)	16
10.4 Requirement for compensation for loss of property /uses due to project actions.....	16
10.5 Public awareness and education- needed for following areas	16
10.6 Design based Environmental/ Social Management considerations	17
10.7 Mitigation of impacts during the construction phase.....	18
10.7.1Construction contractors' requirement to comply with environmental and social management during the construction phase	18
10.7.2 Site Specific mitigation	19
10.7.3 Monitoring requirements specific to the site.....	23
11.Labour management	23
12. Public and Stakeholder Consultations -the public consultations that have been and/or will be held ..	24
13.1 Public Consultations	24
13.2 Stakeholders involved in the consultations any recommendations or agreements reached in the consultations (Refer Annexure II)	24
13. Clearances, no objection, consent, and approvals required for the implementation of the project.....	24

14.1 Project implementation.....	24
14.2 Approval from the state lands owners relevant to the project	24
14.3 Consent/ no objection/ legally bound agreement from the private land ownerships	25
14. Grievance redress mechanism for this site.....	26
15. Information disclosure	26

List of Figures

Figure 1: Road map showing the accessibility to the site	2
Figure 2: Google image of the proposed rock-fall/ landslide mitigation site, the surrounding environmental features and service infrastructure	4
Figure 5a: Damaged and evacuated house (L1).....	8
Figure 5b: Failed down slope section (L1)	8
Figure 5c: Up slope of the LHS of the road (L2).....	9
Figure 5d: Broken part of the fence due to landslide (L2).....	9
Figure 5e: RHS of the Road section and RDA fence (L3).....	9
Figure 5f: Bus stop near to landslide (L3)	9
Figure 5g: Community water line (L3).....	9
Figure 5h: Cracked Road section in road of RHS (L4).....	9
Figure 5i: RHS of the road and RDA fence (L4).....	9
Figure 5m: Access Road to Rubber plantation (L5)	9
Figure 5n: Upslope of the Rubber plantation (L5).....	10
Figure 5o: Damaged Road section with RDA fence (L6).....	10
Figure 5p: Spring near to the mitigation area (L6)	10
Figure 5q: Nagawatta stream and Kumari water confluence area (L6)	10
Figure 5r: Community water line RHS (L6).....	10
Figure 5s: Broken community water line (L7).....	10
Figure 5t: RHS of the road with fence (L7).....	10
Figure 5u: Low risk house near to Landslide (L7).....	10
Figure 5v: Cultivated land of RHS (L8)	11
Figure 5w: Safety RDA fence (L8).....	11
Figure 5x: Damaged Road section due to water flow (L8).....	11

List of Tables

Table 1: Administrative details of mitigation locations	2
Table 2. Selected length of the landslide area along the road (m).	3
Table 4: Summary of the works envisaged under the project.....	8
Table 5: Negative impacts and their level of significance	12
Table 7: Design stage Environmental & Social considerations	17
Table 8: Contractor requirement to comply with ES & HS	18
Table 9: Site specific ES & HS mitigation measures.....	19
Table 10: Environmental and Social monitoring plan; construction phase	23
Table 11: Clearances, no objection, consent and approvals.....	24
Table 12: Tentative timeline for getting approvals	25
Table 13: Proposed scheme of information disclosure	26
Table 14: Level of information gathered through consulting institutions.....	26

List of Annexes

Annexure I: Images of the site condition and the consultation	i
Annexure II: Report on the Stakeholder Consultation: Colombo District	i
Annexure III: Proposed procedure for obtaining approvals from state land owners and environmental agencies.....	ii
Annexure IV: Study team	ii
Annexure: List of references.....	iii

Abbreviations

AIIB	Asian Infrastructure Investment Bank
CEA	Central Environmental Authority
DFC	Department of Forest Conservation
DS	Divisional Secretary
DWLC	Department of Wild Life Conservation
EH & S	Environmental Health & Social
E&SU of PMU	Environmental & Social Unit of Project Management Unit
ESMF	Environmental and Social Management Framework
SSE&SMP	Site Specific Environmental and Social Management Plan
ESMP	Environmental and Social Management Plan
GN	Grama Niladhari
GOSL	Government of Sri Lanka
GSMB	Geological Surveys & Mines Bureau
NBRO	National Building Research Organisation
PRDA	Provincial Road Development Authority
RHS	Right Hand Side
LHS	Left Hand Side

1. Introduction

1.1 Project Overview

The Government of Sri Lanka has received a loan from the Asian Infrastructure Investment Bank (AIIB) for mitigating/rectifying unstable slopes in high-risk areas especially in 13 districts of 06 provinces of the country under the Reduction of Landslide Vulnerability by Mitigation Measures Project (RLVMMP). The project requires to be implemented in accordance with environmental and social safeguards and mandates of the AIIB and that of Sri Lanka. Considering the nature of project actions and its implementation, an Environmental and Social Management Framework (ESMF) has been prepared as required by the AIIB environmental and social safeguard policy.

The purpose of the Environmental and Social Management Framework (ESMF) is to provide a guide for the application of AIIB safeguards and national environmental and social mandates during the implementation of project actions. The project implementing agency (NBRO) is expected to ensure implementation of environmental and social management plans prepared under the ESMF during all phases of project implementation so that the impacts on the environment and community are minimal.

During the scoping exercise, it was revealed that the environmental & social setting and health & safety conditions are more sites specific, and require to be addressed specific to site conditions. Therefore, the ESMF has recommended site specific environmental and social assessments followed by Site Specific Environmental and Social Management Plans (SSE&SMP) for each site. The SSE&SMP gives planning, design, construction and operation phase environmental, social, and health & safety management measures to be considered in the project Implementation.

This is the site-specific environmental and social management plan for **unstable rock fall /landslide locations at Thummodara – Puwakpitiya (B426) road** mitigation site. This plan has been prepared by an in-depth environmental and social assessment to:

- i. Identify sensitive environmental and social elements in the project influence area
- ii. Identify significant environmental and social impacts due to project actions
- iii. Propose mitigation measures
- iv. Decide appropriate environmental and social monitoring requirements specific to this project
- v. Study relevant environmental regulations and procedures to be followed during project implementation specific to the site

1.2 Intended users

The document provides an in-depth insight into site-specific environmental and social issues associated with the proposed project and the mitigation measures and intends to be used by the landslide mitigation design team, the PMU and the contractor in the implementation of the Environmental and Social Management component of the project. The SSE&SMP is published in on the project website (<https://rlvmmp.lk/>) and can be viewed by wide range of interested parties (public, stakeholder organizations) can be utilized by the contractors for the project and will form the basis of site-specific management plans that will be prepared by the contractors as part of their Site Specific Environmental and Social Management Action Plans (SSE-SMAP) prior to commencing works.

1. Description of the project

2.1 Name of the project

Rectification of Site No. 188, Colombo District, for **unstable rock fall /landslide locations at Thummodara – Puwakpitiya (B426) road**

2.2 Location details

Eight (8) unstable locations (named as L1-L8) are identified on the road stretch from Chainage. 0+300 to 7+900 of the Thummodara– Puwakpitiya road (B426). All the sites are within the Colombo district of Western Province Sri Lanka. *Ref, Table 1. Administrative details of mitigation locations.*

Table 1: Administrative details of mitigation locations

No	Location	GPS Coordinates	GN Division	DS Division
L1	Location 01 (0 + 300 to 0 + 400)	6.864623 N, 80.169216 E	458 A Thunmodara	Padukka
L2	Location 02 (1 + 150 to 1 + 300)	6.872005 N, 80.170175 E	442 C Ilukovita	Seethawaka
L3	Location 03 (1 + 500 to 1 + 700)	6.873145 N, 80.170320 E	442 C Ilukovita	Seethawaka
L4	Location 04 (5 + 425 to 5 + 450)	6.904532 N, 80.180955 E	442 F Digana	Seethawaka
L5	Location 05 (6 + 250 to 6 + 400)	6.910128 N, 80.189599 E	442 F Digana	Seethawaka
L6	Location 06 (6 + 600 to 6 + 675)	6.912934 N, 80.184599 E	431 F Weeragolla	Seethawaka
L7	Location 07 (7 + 150)	6.914583 N, 80.186281 E	431 F Weeragolla	Seethawaka
L8	Location 08 (7 + 900 to 7 + 700)	6.920792 N, 80.187970 E	431 F Weeragolla	Seethawaka

Nearest town and accessibility to the site

Puwakpitiya town is approximately 2.5 km from Location 8, situated at the Thummodara– Puwakpitiya road (B426) end, while it is only 7.3 km from Location 1 to Location 8. The site is accessible via the Thummodara- Padukka (B426) Road. (*Ref. fig. 1*)

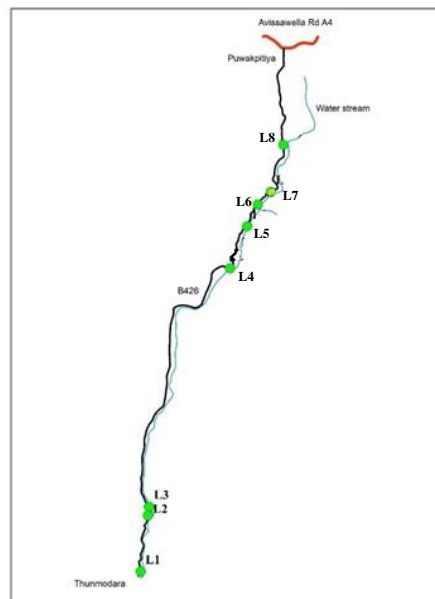


Figure 1: Road map showing the accessibility to the site

2.3 Topography and Land Ownership


The proposed mitigation site is located at the Thummodara– Puwakpitiya Road (B426). The area sits at an elevation of 103 m. The rock fall and landslide-prone area lies on steep, sloping terrain, where the natural slope was cut to construct the road.

All the locations L1 to L8 are within the private ownership. The road reservation area at the toe of the landslide is owned by the Road Development Authority. Ref, Table 2. Selected length of the landslide area along the road (m).

Table 2. Selected length of the landslide area along the road (m).

Location	Selected length of the landslide area along the road (m)
L1	60
L2	32
L3	172
L4	72
L5	121
L6	57
L7	108
L8	136

Refer figure 2; Google images of the proposed rock fall and landslide mitigation site, the surrounding environmental features and service infrastructure.

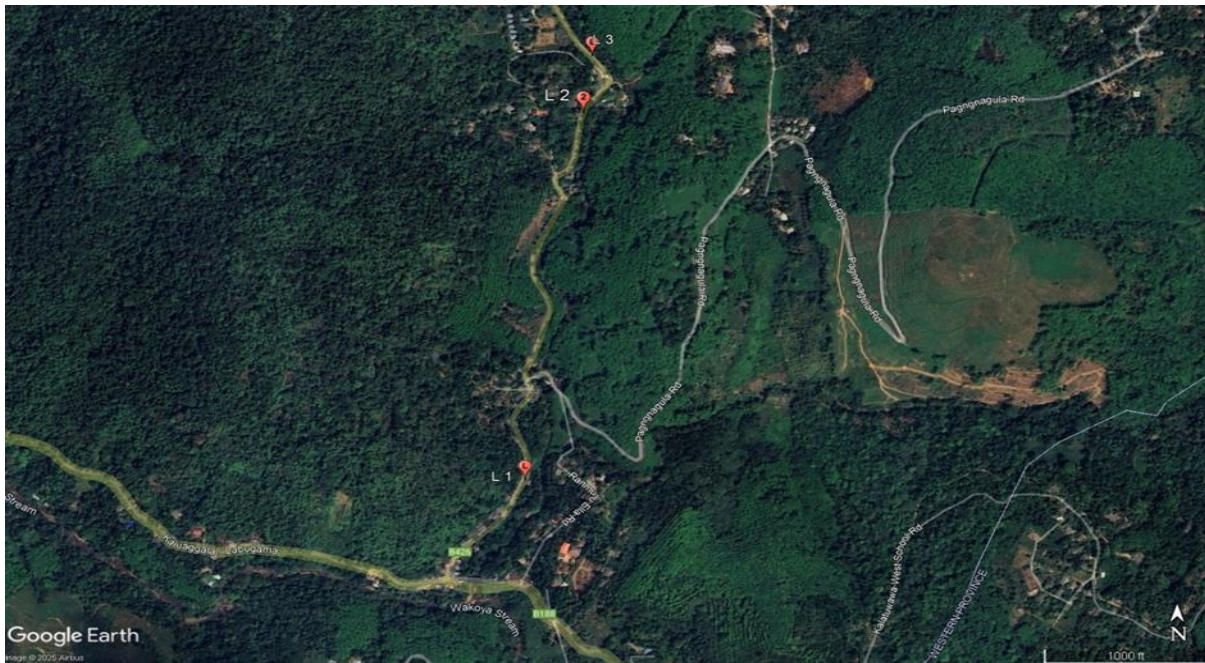

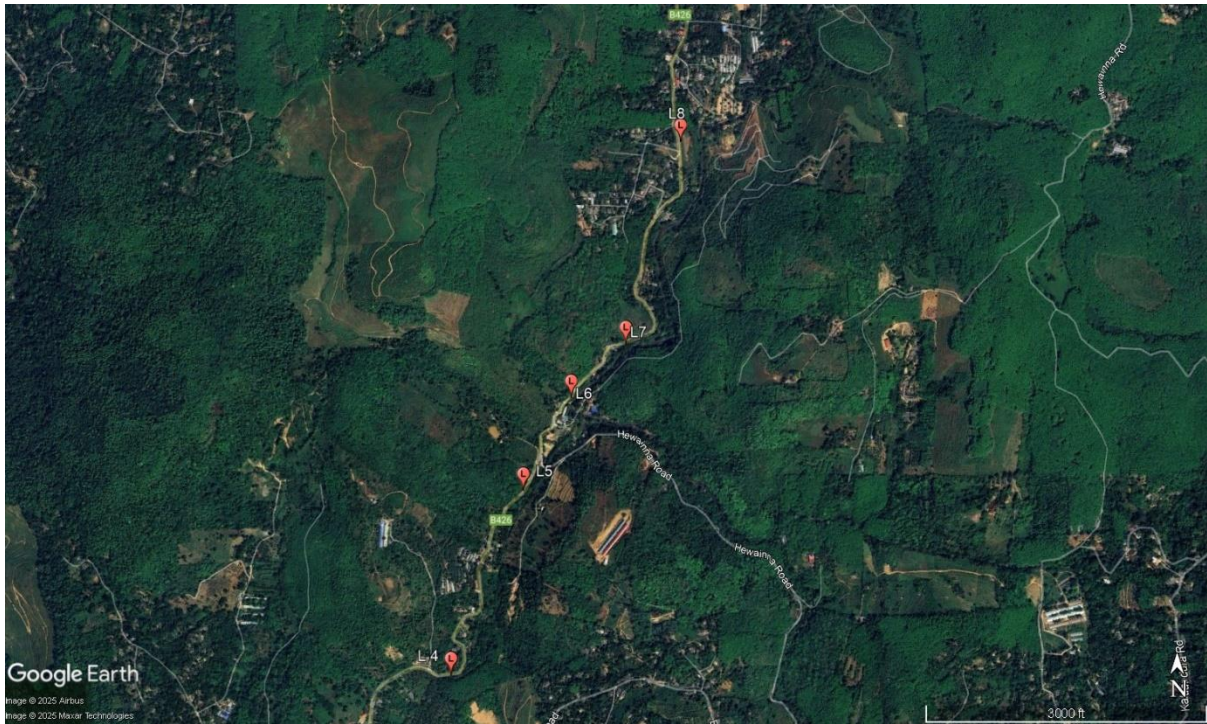


Figure 2: Google image of the proposed rock-fall/ landslide mitigation site, the surrounding environmental features and service infrastructure

2.4 Meteorology of the area (Padukka)

Annual average rainfall – 329.2mm
 Annual average temperature – 28.86°C
 (Source: <https://weatherandclimate.com/sri-lanka>)

2. Rock falls/ Landslides hazard incident details

3.1 Account of incident

There have been multiple rock fall and slope failure incidents, temporary road blocks Thummodara-Puwakpitiya Road. Rocks and soil mass fall incidents have happened in nine locations near bends on right hand side (RHS) sides of the road. When the rock falls happen, the entire road is blocked and closed for a few hours or days until the rocks are removed and road section is cleared. During the incident, the fallen rock boulders and soil mass obstructed the traffic fleet, tourism, and business activities of the area.

3.2 Effects and consequences of Rock falls/ Landslides

No accidents or casualties were recorded due to the rock fall and slope falling incidents. Cracks on the road and road subsidence were observed as the physical damages to the road. Some small-scale landslides have occurred, with debris falling onto the road, creating hazards for travelers.

3.3 Description of any remedial measures already undertaken to reduce the potential risk

Relevant Government Authorities (RDA) have implemented rock barriers, slope stabilization steel nets, and warning signs to reduce risks. Especially during heavy rains, and drivers are advised to exercise caution when traveling through this scenic yet hazardous route.

Accordingly, considering the risk situation and the emergency at the place, it has been proposed to mitigate these locations under the RLVMM project. The site investigation report by the NBRO has

recommended long-term and short-term Rectification measures for the site to maintain slope stability and design for prevent rock falling.

3.4 Evacuations

One house was evacuated receiving government compensation and settled at No: 01 mitigation area and no evacuations have been undertaken to reduce the potential risk of rest of the area.

3.5 Resettlement (progress)



No resettlement or relocation plan has been proposed for this site.






3. Description of the area of the rock fall, areas adjacent to the rock fall and current level of risk


4.1 Area of the rock falls / slope failures

The Thummodara - Puwakpitiya Road (B426) is a by road to the Colombo – Ratnapura main road. According to the geological and morphological settings of the area, rock falls and debris flows are common in this part of the road at any time. The table 2 below summarizes the important Environmental Features, and recommendations to reduce rock fall/ landslide risk. (Source: NBRO report on “ENGINEERING ASSESSMENT OF THE SITE CONDITION AND FAILURE” and data acquisition during site visit on 22nd July, 2025).

Table 3: Summary of important environmental features and recommendation to reduce the rock fall/ landslide risk

Location No	Location	Important Environmental Features	Observations	Recommendations
L1	0 + 300 to 0 + 400		<ul style="list-style-type: none"> Down-slope has eroded near to the road shoulder due to uncontrolled surface runoff. Stream was observed at the bottom of down slope 	<ul style="list-style-type: none"> As an immediate measure, applying a curb drain at road shoulder to divert the rain runoff is recommended. As a long-term measure, the 2 m high gabion wall (40m long) is recommended to stabilize.
L2	1 + 150 to 1 + 300		<ul style="list-style-type: none"> Downslope has eroded near to the road shoulder due to uncontrolled surface runoff River was observed at the bottom of downslope Slope is approximately 8m high 	<ul style="list-style-type: none"> As an immediate measure, applying a curb drain at road shoulder to divert the rain runoff is recommended. As a long-term measure, the 1.5 m high gabion wall (15 m long) is recommended to stabilize.

L3	1 + 500 to 1 + 700		<ul style="list-style-type: none"> Downslope has eroded near to the road shoulder due to uncontrolled surface runoff Slope is approximately 8m high Upper slope at LHS has protected with a retaining wall 	<ul style="list-style-type: none"> As an immediate measure, applying a 200 m curb drain at road shoulder to divert the rain runoff is recommended. As a long-term measure, the 10 m cascade drain (450 X 450 mm) is recommended to stabilize.
L4	5 + 425 to 5 + 450		<ul style="list-style-type: none"> Downslope has eroded near to the road shoulder due to uncontrolled surface runoff Slope is approximately 15m high and there is river flow at bottom of the slope 	<ul style="list-style-type: none"> As an immediate measure, applying a curb drain at road shoulder to divert the rain runoff is recommended. As a long-term measure, the 2 m high gabion wall (25 m long) is recommended to stabilize.
L5	6 + 250 to 6 + 400		<ul style="list-style-type: none"> Downslope has eroded near to the road shoulder due to uncontrolled surface runoff Upper slope at LHS is consisting of rock 	<ul style="list-style-type: none"> As an immediate measure, applying a curb drain at road shoulder to divert the rain runoff is recommended.
L6	6 + 600 to 6 + 675		<ul style="list-style-type: none"> Downslope has eroded near to the road shoulder due to uncontrolled surface runoff Small subsidence can be observed at the road edge 	<ul style="list-style-type: none"> As an immediate measure, applying a curb drain (75 mm) at road shoulder to divert the rain runoff is recommended. As a long-term measure, the 3 m high gabion wall (20 m long) is recommended to stabilize.
L7	7 + 150		<ul style="list-style-type: none"> Downslope has eroded near to the road shoulder due to uncontrolled surface runoff Slope is consisting of rock boulders River flow at bottom of the slope 	<ul style="list-style-type: none"> As an immediate measure, applying a curb drain (75 mm) at road shoulder to divert the rain runoff is recommended.

L8	7 + 900 to 7 + 700		<ul style="list-style-type: none"> Downslope has eroded near to the road shoulder due to uncontrolled surface runoff 	<ul style="list-style-type: none"> As an immediate measure, applying a curb drain at road shoulder to divert the rain runoff is recommended. As a long-term measure, the 1000m X 500mm high RRM wall (200 m long) is recommended to stabilize.
----	--------------------	---	---	--

4.2 Areas adjacent to the rock falls / slope failures

As photographs shown in Table 2, and Figure 5, the areas adjacent to the rock fall / slope failures are covered with dense vegetation and houses are located close to the mitigation site. Wak oya flows by the side of the mitigation area. Both local and foreign tourists visit famous places through road to Ranmudu Ella, Kumari Ella and Seethawaka Botanical Garden are the most popular destinations who can visit while pass this road. Thummodara – Puwakpitiya road is access road to Kalatuwa and Labugama reservoir. These locations, combined with the scenic, make this region a perfect getaway for nature lovers, adventure seekers, and cultural explorers.

4.3 Current level of risk

The Thummodara - Puwakpitiya Road (B426) is highly prone to landslides and rock falls due to its steep terrain, heavy rainfall, and unstable geological formations. This area has experienced multiple incidents over the years, affecting road safety. The rock falls and slope failures will occur again with the upcoming rains and the road will be blocked. During the rainy season, it poses a high risk to commuters and vehicle transportation on the road, and tourists.

The situation of rock falls along the Thummodara - Puwakpitiya Road (B426) in Sri Lanka has been an ongoing concern due to the mountainous terrain and frequent heavy rainfall. The road, which connects Colombo to Avissawella as by road, is prone to landslides, rock falls, and debris accumulation, particularly during raining.

While safety measures have been improved, travelers should exercise caution, especially in the rainy season. If the site is not rectified to prevent future rock falls and landslides will disturb all functions of vehicle transportation between Thummodara - Puwakpitiya. The commuters, pedestrians, tourists, nearby residents, and their livelihood activities would be at risk due to these unstable rock falls and debris falls of the slope sections. The obstruction of accessibility may pose a significant impact on the tourism sector of the country, lifeline facilities, services, and related economic activities including transactions.

5. Description of the works envisaged under the project

Based on preliminary investigations, the NBRO has conducted detailed assessments and designed appropriate rectification measures to mitigate the risks posed by unstable rock fall and slope failure sections. These measures aim to ensure the safety of commuters and tourists while maintaining the continued, uninterrupted function of this vital roadway. Given the potential for further rock falls, especially during heavy rainfall, the following recommendations are proposed to reduce the immediate risk.

Table 4: Summary of the works envisaged under the project

Location No	The works envisaged under the project
Location 1	Applying a curb drain at road shoulder to divert the rain runoff Install 2m high gabion wall (40m long)
Location 2	Applying a curb drain at road shoulder to divert the rain runoff Install 1.5m high gabion wall (15m long)
Location 3	Applying a curb drain at road shoulder (200m long) to divert the rain runoff Install 10m cascade drain (450 X 450 mm)
Location 4	Applying a curb drain at road shoulder to divert the rain runoff Install 2m high gabion wall (25m long)
Location 5	Applying a curb drain at road shoulder to divert the rain runoff
Location 6	Applying a curb drain at road shoulder (75m long) to divert the rain runoff Install 3m high gabion wall (20m long)
Location 7	Applying a curb drain at road shoulder to divert the rain runoff Install cascade drain
Location 8	Applying a curb drain at road shoulder to divert the rain runoff Install RRM wall 200m long (1000 X 500 mm)

6. Brief description on the surrounding environment with special reference to sensitive elements that may be affected by the project actions

The elements and services at risk during the project implementation are;

- i. The Thummodara - Puwakpitiya Road (A26)
- ii. Commuters and pedestrians
- iii. Water seepages and streams
- iv. Houses and residents near the locations
- v. Current services, economic and tourism activities of the area

(Ref. Fig.5 Sensitive elements that may be affected by the project actions)



Figure 5a: Damaged and evacuated house (L1)



Figure 5b: Failed down slope section (L1)



Figure 5c: Up slope of the LHS of the road (L2)



Figure 5d: Broken part of the fence due to landslide (L2)



Figure 5e: RHS of the Road section and RDA fence (L3)



Figure 5f: Bus stop near to landslide (L3)



Figure 5g: Community water line (L3)



Figure 5h: Cracked Road section in road of RHS (L4)



Figure 5i: RHS of the road and RDA fence (L4)



Figure 5m: Access Road to Rubber plantation (L5)



Figure 5n: Upslope of the Rubber plantation (L5)



Figure 5o: Damaged Road section with RDA fence (L6)



Figure 5p: Spring near to the mitigation area (L6)



Figure 5q: Nagawatta stream and Kumari water confluence area (L6)



Figure 5r: Community water line RHS (L6)



Figure 5s: Broken community water line (L7)

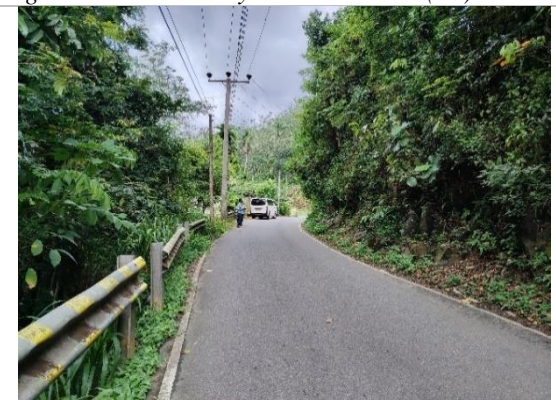


Figure 5t: RHS of the road with fence (L7)



Figure 5u: Low risk house near to Landslide (L7)



Figure 5v: Cultivated land of RHS (L8)



Figure 5w: Safety RDA fence (L8)



Figure 5x: Damaged Road section due to water flow (L8)

Figure 5: Sensitive elements that may be affected by the project actions

7. Identification of social and environmental impacts and risks related to the works

7.1 Positive impacts

- The objective of this project is to ensure that further occurrences of rock falls and landslides are prevented at an acceptable level. The remediation may secure the cost of road rehabilitation from future rock falls in the area.
- Both local and foreign tourists visit famous places through road. Kumari ella, Ranmudu ella and Seethawaka Botanical Garden are the most popular destinations who can visit while pass this road. These locations make this region a perfect getaway for nature lovers, adventure seekers, and cultural explorers.
- The proposed project will significantly enhance the safety of the road for commuters, tourists, and pedestrians during the rainy season and will allow keeping the road open throughout the year.
- Downslope communities and settlements will be prevented from rock falls and landslides of future slope failures.

7.2 Negative impacts

The mitigation works are generally confined to already rock-fall areas. Therefore, negative impacts are much localized and also limited to the construction period.

Table 5: Negative impacts and their level of significance

Impacts during the construction period	Level of Significance
7.2.1 Hydrological and water quality impacts	
<p>7.2.1.1 Impacts of the drainage pattern of the area Disruption to existing surface and sub-surface drainage patterns in the area is envisaged with the project implementation. During the rainy season, heavy flow of water is expected to be generated and accumulated between the road and the slope. The water inundation of the existing drainage may be expected. An increase of water through the unstable slope may intensify the risk of rock falls and landslides in the unstable sections.</p>	Significant
<p>7.2.1.2 Water pollution and impacts on surface water quality During the slope excavation, the removal of debris and rocks can generate high sediment-laden runoff there could be a possibility that contaminated runoff may pollute the water. Improper disposal of oils and other harmful substances/contaminants from machinery, leakages from temporary storage tanks, solid waste, and wastewater disposal/dumping could occur causing adverse impacts on the quality of the water. However, during the rainy season, the rainwater running through the disturbed slope tends to pick up sediment, oil, and other pollutants generated during construction can contaminate the water. As there are seasonal recharging water seepages and the community uses water springs and tanks nearby, the water pollution impact is highly significant.</p>	Highly Significant
<p>7.2.1.4 Open defecation and waterborne infections As the mitigation locations are located close to the road, the possibility of open defecation is low.</p>	Insignificant
<p>7.2.1.5 Impacts on the downslope water users The construction activities will be carried out on steep slopes consisting of unstable rocks. Therefore, the slope will be prone to rock falls during the rock removal phase. This may increase the risk of rock falling into downslope area. As there is a natural water spring in the mitigation areas, the rock or sediment loading impact on the water resource is highly significant.</p>	Highly Insignificant
<p>7.2.1.6 Impacts on groundwater table and groundwater quality The addition or mixing of construction materials including cement, and grout materials with sub-surface water flows will cause temporary water quality degradation and accumulation of unwanted substances. During the construction period, the hazardous waste from chemical substances, wastewater from the construction activities, and discharge of waste matter from onsite septic systems would cause adverse impacts on the groundwater quality as the water of the natural spring may be used by the residents. Due to the mitigatory activities carried out in the slope area, the groundwater quality or water table draw-down impacts will be significant because there are natural ground water sources in that area.</p>	Highly Significant
<p>7.2.1.7 Impacts on water or wetlands Improper disposal of oils and other harmful substances/contaminants from machinery, leakages from temporary storage tanks, solid waste, and wastewater disposal/dumping from workers' sites could occur causing adverse impacts on the quality of the water. This impact may be significant as the area is rich in ground water springs.</p>	Significant
7.2.2 Environmental Impacts	

<p>7.2.2.1 Noise and Vibration Impacts Noise and vibration are expected from construction equipment. The tourists, vendors, pedestrians, and commuters on roads will also be affected from noise and vibration. The residents nearby, commuters, and tourists on the road will be exposed to high noise during heavy noise-generating activities, such as operating loading and unloading of materials, and movement of machinery in addition to above-mentioned construction works.</p>	<p>Highly Significant</p>
<p>7.2.2.2 Air pollution impacts Construction activities that contribute to air pollution include: land clearing, operation of diesel engines, demolition, and burning. Operating vehicles at high speed under dry weather conditions can increase such pollution. Improper handling and transferring of materials can also generate dust. Improper storage of materials can potentially generate dust if not properly covered. During construction, it generates high levels of dust typically from concrete, cement, wood, stone, and silica. The road is used heavily for vehicles moving (buses, bicycles, lorries, trucks, tippers, three wheels). The air pollution may have a significant impact on nearby residents, tourists, commuters, and pedestrians. The air pollution impacts from the construction are locally significant during dry periods for commuters, nearby residents, and tourists.</p>	<p>Highly Significant</p>
<p>7.2.2.3 Solid Waste Disposal Issues Haphazard disposal of solid waste; various types of waste such as litter, food waste, and construction waste will be generated and may be stored or dispose on site. The littering and hazard storage and disposal of solid waste in and around the site will create inconveniences for the nearby residents, commuters, pedestrians, and tourists. It can block the drainage to make breeding grounds for waterborne diseases. Waste can pollute the soil, and leave various environmental impacts if a proper disposal mechanism is not in place during the construction period.</p>	<p>Highly Significant</p>
<p>7.2.2.4 Explosive hazards and hazardous materials Since the affected area has some rock boulders, explosives may be used if the rock blasting is envisaged. This may pose a risk due to unsafe use. As these operations are to be done on affected slopes the risk of improper use of explosives and accidents from rock fragments are highly significant.</p>	<p>Highly Significant</p>
<p>7.2.3 Biological /Ecological Impacts</p>	
<p>7.2.3.1 Effects of Important Wildlife Habitats There is a forest reserve in upslope areas within the project influence area. Important wildlife habitats may be impacted due to construction activities such as high noise generation activities.</p>	<p>Significant</p>
<p>7.2.3.2 Effects on Fauna & Flora The majority of the trees found in the area are not endemic, threatened and identified in the red list of IUCN. But there may be some species within the forest reserve. These species may be impacted.</p>	<p>Significant</p>
<p>7.2.4 Social and Economic Impacts</p>	
<p>7.2.4.1 Impacts on agriculture within the area to be remedied/ immediately to the site There is no cultivation immediately adjacent to the rock fall slope area. During the construction period, the land use pattern may not be affected.</p>	<p>Insignificant</p>

<p>7.2.4.2 Cracks in the road/houses/shops due to vibration and blasting impacts The unstable rockfall locations are situated adjacent to the road, which runs directly through the site. Vibrations from construction activities could create or worsen cracks on the road. Additionally, houses and shops are located downslope of the proposed mitigation sites, making the impact of vibrations and rock blasting on residents and buildings highly significant. The use of heavy machinery and blasting chemicals during construction may further widen existing cracks or cause new ones to develop in downslope structures.</p>	<p>Highly Significant</p>
<p>7.2.4.3 Loosing access to land and future development activities The land where the project activities are envisaged belongs to the road reservation of RDA and the mitigation works will be concentrated on upslope of the road. This area is a mainly a sloppy land, there will be no impacts to the land owners with regard to loosing access to the land (during construction) and loss to valuable use of the land. In contrary, remediation works in the upslope will increase the stability of the boundary and protect the land from future rock falls.</p>	<p>Insignificant</p>
<p>7.2.4.4 Impacts on livelihood/ business and income activities The community activities of the area immediately adjacent to the unstable rock fall sites would be affected during the construction period. Both local and foreign tourists, and vehicle parking facilities would be highly interrupted during construction phase. This would affect the safety of the nearby community.</p>	<p>Highly Significant</p>
<p>7.2.4.5 Impacts on service provision (water supply, sewage, electricity) The road, electricity, water supply lines running through the mitigation area will be impacted.</p>	<p>Significant</p>
<p>7.2.4.6 Effect due to loss of infrastructure and safety During the construction phase, the road from Thummodara to Puwakpitiya road will be obstructed by frequently moving machinery, loaders, trucks etc. Therefore, most of the heavy machinery, trucks and loaders can obstruct the pedestrian passage, parking area and cause traffic during the construction period. The effect is highly significant.</p>	<p>Highly Significant</p>
<p>7.2.4.7 Work camps and lay-down site requirements The camp site will be selected in the neighbourhood of community. If proper camp management is not in place, it may result several labour issues, social issues with community, conflicts for shared resources with the community, nuisances, and management of waste etc. If temporary camps are built in the close proximity of the site, management of solid waste and sewage will be an issue.</p>	<p>Significant</p>
<p>7.2.4.8 Relations between workers and people living in the vicinity of the site and possibility of disputes The construction workers at this site will be from different social backgrounds and from different geographical areas often under poverty. Usually, they are with poor educational and social background. Such communities may have a wide range of social issues to cause dis-stress on the neighbouring community and the workers of the project. Although the workers who would engage in such issues will be rare, even few possibilities cannot be ignored.</p>	<p>Highly Significant</p>

<p>7.2.4.9 Workers safety during construction The workers may be exposed to risk from falling. Fatal injuries may occur if the rock falls. The risk of rock fall is aggravated during the rainy season. This risk is highly significant. Risk of hazard from vehicle and construction machinery accidents is highly significant at this site. Contractor may engage under age workers (children) for construction work, which is risky and can results serious accidents and injuries.</p>	Highly Significant
<p>7.2.4.10 Safety to the public from construction activities: High risk for commuters/tourists During construction phase the road will be obstructed by the frequently moving machinery, loaders, trucks etc. As most of the mitigation works are to be carried out in limited space on slopes the heavy machinery, the trucks and loaders etc. can obstruct the commuter /downslope residents/tourists and may pose high risk on their life. There is a risk of falling loose rocks on the road during excavations and removal of rocks posing risk on the residents who live in nearby two houses, commuters. The same risk at a high level will be there for the residents and houses located in upslope as they will be exposed to a longer duration to this risk during the construction phase. Therefore, the risk on them is highly significant. Therefore, the risk on them is highly significant.</p>	Highly Significant
<p>7.2.4.11 Impacts on transport infrastructure (especially temporary loss of road, risks of traffic congestion) The traffic due to full/partial road closure may obstruct the smooth flow of vehicles during the week days, in office hours, school times, on holy days. This will cause nuisance to pedestrians and commuters.</p>	Significant
<p>7.2.4.12 Areas used for businesses, agriculture or other immediately adjacent to the site The machinery movement and material transportation would have an impact for the tourism related business activities. For the construction activities some spaces of them needed to be occupied and this will have an impact on the income of the nearby community. However, considering the rock fall risk, the income losses for short period will be minimal.</p>	Significant
<p>7.2.4.13 Need for people to enter or cross the site Excavation machinery, loaders, trucks etc. will be used in the area used to access in to the unstable slope area. There is no special need for commuters, tourists or other neighbouring community to enter the site for other purposes. However, unauthorized entry of ordinary people may occur due to intentional or unintentional purposes and they may be at risk due to operating machinery, vehicles, electricity, and may be blasting materials.</p>	Highly Significant

8. Site Specific Risk Analysis

Table 6: Site specific risk analysis

Risk	Affected group	Risk level
1. Facing accidents when working close to the road	Workers	Very high
2. Transporting materials and machinery	Workers/ tourists	Very high
3. Throw out disposals (litter, bottles, and food) to the construction site from the commuters.	Workers/tourists/ commuters	Very high
4. Facing accidents during constructions at night time	Workers	Very high
5. Accidents from the construction activities and materials placed close to the road	Workers/tourists/ Commuters	Very high

6. Injuries due to rock particles due to explosions/ blasting	Workers/tourists/ /Commuters	Very High
7. Rock fall from the unstable area	Workers/tourists/ Commuters	High
8. Work with electrified supply lines	Workers	High
9. Site Working – Working in poor visibility	Workers	High
10. Lone Working	Workers	High
11. Emergency evacuation	Workers	High
12. Extreme weather conditions (wind, rain etc.)	Workers	High

9. Significant Environmental and Social Impacts

Environmental, social impacts or risks that will require special attention on the part of NBRO.

9.1 Priority Health and Safety Issues. Specific H&S concerns that require measures that go beyond the standard contractual requirements for contractors

The health and safety issues pertinent to this site is significant as the workers have to work on an unstable slope with a risk of rock falling. Such common E & HS issues have been discussed in the **ESMF**. Worker safety requirement in the construction site is more detailed under 2003 5: Safety equipment and clothing in the section 2003: Working conditions and community health and safety in the bidding document.

9.2 Child labour & forced labour

Child labor & Forced labor is detailed under 2003.3 under section 2003: Working conditions and community health and safety in the Bidding document.

10. Environmental Social Management Plan (ESMP)

Measures to manage and or mitigate the impacts and risk. Especially the significant impacts and risks identified in sections 7 & 8. This section will include the specific recommendations and requirements of the ESMP for design stage, construction phase and maintenance operation phase.

10.1 Resettlement action plan

There is no project-based resettlement in this site.

10.2 Evacuation of people

Project based evacuation is required for the site No: I site.

10.3 Procedure for removal of damaged structures, facilities infrastructure (consent from owners to remove the articles)

This risk may not be triggered in this site.

10.4 Requirement for compensation for loss of property /uses due to project actions

This risk may not be triggered in this site.

10.5 Public awareness and education- needed for following areas

- i. Programs to inform and educate people in the vicinity and the nearby residents about the risks posed by unstable rock land section.
- ii. Requirement for special awareness for tourists, commuters and the people passing through the area using the road with potentially high-risk during construction phase and early warning.

10.6 Design based Environmental/ Social Management considerations

The site is located in an aesthetically beautiful, environmentally sensitive natural environment in the rural setup. Hence, following environmentally and socially significant design considerations are recommended.

Table 7: Design stage Environmental & Social considerations

Design feature	Recommended level of consideration for this site
<p>i. Natural resource management and resource optimized designs</p> <p>Project specific designs should be considered to eliminate mass clearing of vegetation and minimum number of removals of grown tree species. Sufficient emphasis should be made to consider conservation of trees if important tree species are found.</p>	Very High
<p>ii. Site Planning</p> <p>During site planning it is necessary to be cautious on possible re-activation of rock falls. Also, the locations are located in a very limited space of slopes with high risk bending road. The vehicle parking sites, material storage and temporary shelters etc. should not be installed in the danger zones of the rock falls. It is very necessary to keep trained flagman or safety officer during the construction period and proper communication between contractor's workforce and the other responsible officials should be maintained.</p>	Very High
<p>iii. Habitat connectivity and animal trails</p> <p>If large fractions of vegetation are required to be cleared in ecologically fragile habitats as for permanent structures or for access, or if deep drains etc. are to be made the designs should include habitat connectivity features, animal trails and vegetation strips and etc. even if the impacts are localized.</p>	High
<p>iv. Conservation of water resources</p> <p>If involves extraction of water both surface and sub-surface. The water extracted is in relatively good quality. In a well thought design this extracted water can be conveyed in such a manner that the water can be accessed by wild fauna as well as the neighboring communities for bathing and other domestic purposes</p>	Very High
<p>v. Interruption to water supplies</p> <p>If the water in the mitigated slope is used as a source for individual or community water supply, the chance the water source can be affected by the mitigation work is high due to water table draw down.</p>	Very High
<p>vi. Aesthetically compatible design considerations</p> <p>The designs in aesthetically sensitive environments should consider structures that blend with natural environment to keep the visual pollution to minimum. Greening could be used in construction activities to develop the area as a tourist attraction. Service of landscape architect may be important for the design of suitable mitigation structures.</p>	Very High
<p>vii. Consideration of green environmental features</p> <p>As many of the mitigatory works are carried out in ecologically sensitive habitats, it is recommended to consider green environmental designs as much as possible in the designs e.g.: use of local vegetation species for erosion control, combination of plants to sustain species diversity in the environment, avoiding inclusion of potentially invasive species & etc.</p>	Very high

<p>viii. Conservation of environmental, social and cultural features</p> <p>The local cultures and heritages are strengthened by their close connections to the natural environment that sustains them. Therefore, the project actions should be carried out considering local culture and social aspects, providing opportunities to reinforce them during the project actions.</p>	<p>Very high</p>
<p>ix. Workers/ commuters and community safety</p> <p>Due to the close proximity to the roads people may face accidents specially the workforce during the construction phase. Unauthorized entry and ignorance may cause severe accidents around the site. Activation of slides or rock falls may occur during construction phase and may pose threat to workers, tourists, businessmen, passengers and commuters. Therefore, design-based safety consideration such as beams, safety nets etc. should be considered.</p>	<p>Very high</p>
<p>x. Erosion control structures</p> <p>During rainy season the flow of drainage structures can be significantly high and this may cause stream bed erosion. Hence the design should adequately consider flow speed breakers to reduce erosive flows entering natural streams. This should be an inclusive part of the design if there are streams and culverts in the proximity of the mitigation site.</p>	<p>High</p>

10.7 Mitigation of impacts during the construction phase

10.7.1 Construction contractors' requirement to comply with environmental and social management during the construction phase

Measures to manage and to mitigate the environmental and social impacts are generally common to all landslide mitigation sites. Such impacts are largely attributed to activities in the construction phase. The mitigation of impacts therefore becomes an obligation of construction contractor. NBRO has prepared a comprehensive document on “*contractors’ requirement to comply with Environmental and Social Health and Safety (ES & HS) management during the construction phase*” to be included in construction contractors’ bid document. The main sections are summarized below (Table 4) indicating the degree of relevancy for this site. For details ESMP for construction contractors should be referred.

Table 8: Contractor requirement to comply with ES & HS

Reference No. as per construction contractor’s obligation to ESMP	Item	Relevant to the project
2002. Environmental and Social Monitoring		
2002.2 1)	Storage on site	Highly Relevant (road reservation)
2002.2 2)	Noise and Vibration	Highly relevant (commuters, tourists)
2002.2 3)	Cracks and damages to the buildings	Relevant
2002.2 4)	Disposal of waste	Relevant (commuters, tourists)
2002.2 5)	Disposal of refuse	Highly relevant (road reservation)
2002.2 6)	Dust control	Highly Relevant (commuters, tourists)
2002.2 7)	Transport of Construction materials and waste	Relevant
2002.2 8)	Water	Relevant
2002.2 9)	Flora and Fauna	Relevant
2002.2 10)	Physical and cultural resources	Relevant
2002.2 11)	Soil Erosion	Relevant
2002.2 12)	Soil Contamination	Relevant
2002.2 13)	Borrowing Earth	Relevant
2002.2 14)	Quarry Operations	Relevant
2002.2 15)	Maintenance vehicles and Machinery	Relevant
2002.2 16)	Disruption to public	Highly relevant (community, tourists nearby)
2002.2 17)	Utilities and roadside amenities	Highly relevant (road)

2002.2 18)	Visual environment enhancement	Highly relevant
2002-5. Environmental Monitoring	Baseline surveys (air, water, noise, vibration, crack surveys)	Refer site specific monitoring plan
	Surveys during construction (air, water, noise, vibration, crack surveys)	Refer site specific monitoring plan
	Surveys during operation phase	Refer site specific monitoring plan
	Reporting and maintenance of records	Relevant
2003. Working Conditions and Community Health and Safety		
2003.2	Safety organization and communication	Highly relevant (unsafe slope, commuters, tourists, pedestrians, heavy machinery)
2003.3	Child Labor and Forced Labor	Relevant
2003.4	Safety reports and notification of accidents	Highly relevant
2003.5	Safety Equipment and Clothing	Highly relevant
2003.6	Safety inspections	Highly relevant
2003.7	First Aid Facilities	Highly relevant
2003.8	Health and safety information and training	Highly relevant
2003.9	Plant equipment and qualified personnel	Relevant
<p>Relevant: The section is relevant to the site as a common ESMP applicable to any site</p> <p>Highly relevant: The contractor should pay special emphasis in the preparation of environmental method statements to ensure that the relevant ESMP is implemented specific to the site</p> <p>Possibly relevant: This ESMP will be triggered if the site come across with relevant aspect during project implementation</p> <p>Not relevant: The section may not be relevant to this site under disclosed conditions</p> <p>Optional: require to be implement if needed only</p> <p>Refer site specific monitoring plan: Contractor is obliged to carry out monitoring as specified in the site-specific monitoring plan</p> <p>Reference: Contractors Obligation for implementation of ESMP</p>		

10.7.2 Site Specific mitigation

Given below are the site-specific mitigation measures that the project is expected to implement during the construction period.

Table 9: Site specific ES & HS mitigation measures

Mitigation item	Project implementation phase	Responsibility
<p>i. Minimize erosional impacts during construction</p> <p>It is recommended that mitigation works involved with site clearance, slope reshaping, removal of rocks etc. are avoided during rainy season. Therefore, it is imperative that site works in upslope mitigation are carried out in the dry season and avoid such activities on upslope area in the wet season as much as possible. This should be considered in project planning stage. Safety nets should be introduced to removal of rock boulders.</p>	Site preparation & construction	Construction Contractor
<p>ii. Planning project activities inside the sites</p> <p>As contractor has to operate mitigation actions within site, he should carefully prepare a plan for management of construction activities inside the premises. This should include careful selection of material storage as vehicle parking, mixing of concrete, cleaning activities etc. which considering the safety and optimization of space.</p>	Construction	Construction Contractor

<p>iii. No Entry Zone The PMU should make a detailed assessment on possible risk of slope destabilization in the site during construction phase. “No entry zone” may require to be declared. Also mitigate the risk of accidents from moving vehicles operational machinery construction activities, electrical leakages etc. should be given high priority in the health and safety management plan. Sign boards indicating slope instability risk are strongly recommended at this site</p>	Site preparation and construction	Construction Contractor
<p>iv. Impacts on transport infrastructure (especially temporary loss of road access, risks of traffic congestion) A good traffic control should be implemented in the construction stage. Tourist attractive places adjacent to the site proper road safety measures should be included with warning signs and permanent trained watchmen, luminous sign boards indicating slope instability risk and road obstruction signs, night lamps etc. are strongly recommended at this site.</p>	Construction	Construction Contractor and
<p>v. Priority Health and Safety Issues As the workers in the site have to work in high-risk conditions, it is imperative to implement recommendations given in section 2003 of contractors’ obligation on ESMP under “working conditions and community health and safety”. These recommendations should be followed carefully in a proper organization and safety monitoring system.</p> <ol style="list-style-type: none"> i. Prepare a special Occupational Health and Safety Management Plan prior to commencement of construction activities ii. A good warning system and full-time watchman is highly recommended for this site for workers, tourists, businessmen and commuter safety. iii. Safety barriers and safety nets should be installed at places of risk to protect workers and commuters from boulder falling risk adoption of standard worker safety methods iv. Provision of personal protective equipment (PPE) such as safety boots, helmets, protective clothing goggle etc. v. Provision of training and awareness programs to employees vi. Conducting hazard analysis and plan/provide adequate mitigation measures for such hazards identified, prior to carrying out major construction activities vii. If the wasp nest is in the vicinity, it is mandatory to use Evacuation Centers for ensure of workers’ safety viii. Additionally, work should be discontinued for sufficient time period during rainy period as working on unstable land will be highly risky in the rainy season 	Construction	PMU Construction Contractor
<p>Vi. Throw out disposals (litter, bottles, and food) to the construction site from the commuters. Put up the safety sign boards prior to the construction site indicating people at work. The commuters should be aware about the construction activities through notices erected before reaching the proposed mitigation site.</p>	Site preparation & construction	Construction Contractor
<p>Vii. Injuries due to rock particles due to explosions/ blasting Minimize all blasting activities during peak times and making awareness announcements through the blasting period. Establish an emergency accidents preparedness plan for their injuries due to rock particles due to explosions/ blasting.</p>	Construction	Construction Contractor

<p>Vi. Disposal of construction waste</p> <p>The contractor should pay special attention with respect to disposal of construction waste. Most of the tourists are stopped visit the natural view this area. Therefore, such waste if generated should store properly without getting washed off and dispose according to approved procedures by the PMU. Construction waste should not dispose along the road or into the drainages.</p>	<p>Site preparation & construction</p>	<p>Construction Contractor</p>
<p>ix. Impact on down slope water users</p> <p>Natural drinking & bathing water source is located at the edge of the road. The construction activities may pollute the water quality. It would have a significant impact on the water users.</p>	<p>Site preparation & construction</p>	<p>Construction Contractor</p>
<p>x. Onsite sanitary facilities for the workers</p> <p>The contractor should prepare temporary sanitary facilities for the workforce within the site, to mitigate open defecation of the workers.</p>	<p>Site preparation & construction</p>	<p>Construction Contractor</p>
<p>xi. Dust and aerosol control screens</p> <p>Dust particles generated during the construction period can influence the nearby residents, commuters and tourists. The commuters traveling through the main road specially tourists could be affected from generated dust particles. Special screens etc. should be used if heavy dust or aerosol generating activities are envisaged.</p>	<p>Site preparation & construction</p>	<p>Construction Contractor</p>
<p>xii. Water for construction</p> <p>Water for construction works should be obtained only from the approved sites.</p>	<p>Construction</p>	<p>Construction Contractor</p>
<p>xiii. Working hours</p> <p>The construction activities should be restricted to day time only. Working after 6.p.m. is not recommended for any reason due to safety issues.</p>	<p>Construction</p>	<p>Construction Contractor</p>
<p>xiv. Impact on service infrastructure</p> <p>Telecommunication, electricity, water lines should be relocated before construction starts as per the approval of PMU.</p>	<p>Construction</p>	<p>Construction Contractor</p>
<p>xv. Need for people to enter or cross the site</p> <p>Possible unauthorized access to the site should be avoided by awareness, warning signs and vigilance by the contractor's full-time watchmen.</p>	<p>Construction</p>	<p>Construction Contractor</p>
<p>xvi. During construction good housekeeping should be maintained to minimize visual pollution</p>	<p>Site preparation & construction</p>	<p>Construction Contractor</p>
<p>xvii. Worker's code of conduct</p> <p>Possible disputes between the labor force and the commuters and tourists should be prevented by maintaining the agreed code of conduct by the contractor.</p> <p>Possible disputes between workforce and commuters should be avoided especially when using shared resources such as common bathing and washing places etc.</p>	<p>Construction</p>	<p>Construction Contractor</p>

<p>xviii. Snake bites, toxic insect bite management and emergency management by accidents</p> <p>Proper emergency management system for snake bites and toxic insect bite (include awareness on snake bites, safety shoes while at work, first aid on a snake bite, hospitalization and admission to correct hospital where snake bite management facilities are available) should be introduced.</p> <p>Accidents are common in these kinds of sites. Proper emergency management unit for other accidents (first aids facilities, safety items, hospitalization facilities and transportation facilities) should be maintained for this site.</p>	Construction	Construction Contractor
<p>Xix Machinery and material transportation</p> <p>The concrete paved access road require to use for machinery, materials and vehicle transportation during construction phase. This road is very narrow and there is bend on the road adjacent to the site. Hence, good traffic control should be implemented in the construction stage. Proper road safety measures should be included with warning signs and permanent trained watchmen, luminous sign boards indicating slope instability risk and road obstruction signs, night lamps etc. are strongly recommended at this site.</p> <p>It should not be obstructed the people who are living in downslope by using the road and transporting material and equipment.</p>	Construction	Construction Contractor
<p>Xx. Noise and vibration control</p> <p>The noise and vibration generating activities may disturb the nearby residents and smooth flow of activities of the area. Vibration generating activities should be done within the prescribed limits to avoid damage to structures and houses. Cracks in the buildings should be monitored before, during and after completion of the project.</p>	Construction	Construction Contractor
<p>Xxi. Impact on Home Garden System</p> <p>The residents of this area have their home gardens in upper slope area very closer to the mitigation site. Contractor should pay attention not disturbing these vegetation moving vehicles, parking areas, material dumping etc.</p>	Construction	Construction Contractor
<p>Xxii. Safety structures/sign boards</p> <p>During construction phase adequate safe fencing should be established to prevent potential falling risk of workers from upslope areas.</p> <p>Warning sign board indicating rock fall risk should be displayed at the down slope area; at the road side as the road is occupied by the public for various reasons (commuters, pedestrians and residents etc). As the risk is high during the rainy season where there is no construction work it is mandatory that safety signs boards are displayed even during the no project period as well.</p>	Construction	Construction Contractor
<p>Xxiii. Interruption to water lines</p> <p>The Necessary arrangements should be taken to provide alternative water supply in case of an interruption to water supply.</p>	Construction	Construction Contractor

10.7.3 Monitoring requirements specific to the site

Following monitoring plan is strongly emphasized during the construction phase specific to this site. In addition to this, monitoring procedure indicated in the contractors' obligation to ESMP should also be implemented by construction contractor. The contractor is expected to indicate in the bid the ESMP procedure to be implemented along with relevant proofs of his competency. The cost for ESMP will require to be indicated as a separate pay item. The environmental and social management method statement is expected to be submitted by the selected construction contractor and to be approved by the PMU unit.

Table 10: Environmental and Social monitoring plan; construction phase

Monitoring requirement	Parameters	Frequency
i. Baseline monitoring	Water quality	Once*
	Pre-construction crack survey of the houses	Once*
	Ground vibration	Once*
	Air quality: particulate matter	Once*
	Background noise measurement	Once*
ii. During construction	Water quality	Once*
	Crack survey	-
	Ground vibration	During operation of drilling machinery, boring works, or any works that generate ground vibrations*
	Construction noise	Once a month during heavy noise generation times *
	Air quality particulate matter	Once a month *
iii. Vehicular Emission	All machinery/vehicles operational should have the emission control test certificate as applicable - should be checked by the site ES officer of the consultant	
iv. Monitoring agency	* A competent independent monitoring agency with registration of Central Environmental Authority for all parameters except crack surveys **Crack surveys should be conducted by competent agency acceptable to PMU	
v. Reporting requirements	Stream water quality – Comparison with National Environmental (ambient water quality) regulations, no.01 of 2019 Pre-construction crack survey of the high-risk buildings -Professional report Ground vibration -as per the interim standards on vibration for the Machinery, Construction activities and Vehicular movements, CEA Background noise measurement –Extraordinary Gazette No.924.1, May 23,1996, CEA Air quality particulate matter - The National Ambient Air Quality standards stipulated under the Extraordinary Gazette, No. 1562/22 August 15, 2008 -Central Environmental Authority of Sri Lanka.	

11.Labour management

Sound worker-management relationships, treating workers in the project fairly and providing safe and healthy working conditions is required. Responsibility is lies with the PMU and the construction contractor.

The Objectives are;

- To promote safety and health at work.
- To promote the fair treatment, nondiscrimination and equal opportunity of project workers.
- To protect project workers, including vulnerable workers such as women, persons with disabilities, children and migrant workers, contracted workers, community workers and primary supply workers, as appropriate.
- To prevent the use of all forms of forced labor and child labor.
- To support the principles of freedom of association and collective bargaining of project workers in a manner consistent with national laws.
- To provide project workers with accessible means to raise workplace concerns.

12.Preventive measures for COVID-19 that was issued by Sri Lankan national health authority (this is applicable if Notification on Covid -19 epidemic/ endemic is issued by Health Authorities Sri Lanka)

COVID-19, the novel corona virus infection has not been totally eradicated in the world. Therefore, to prevent/ control of the spread of infection also to prevent panic situations in the event of detecting a suspected case, all contractors are required to develop a COVID-19 Preparedness plan and need implementing in the site as per the “Health and Safety Guidelines for Sri Lankan Construction Sites to be adopted during COVID 19 outbreak” Guidelines given by Construction Industry Development Authority CIDA 29th April 2020.

13.Public and Stakeholder Consultations -the public consultations that have been and/or will be held

13.1 Public Consultations

Residents nearby were consulted and made aware of the mitigation project during the field visit. They stated that the mitigation works are appreciable and expressed their willingness to the project.

13.2 Stakeholders involved in the consultations any recommendations or agreements reached in the consultations (Refer Annexure II)

Mr. Upul Kumara, Work Supervisor and Mr.K.W.Chandana, Labour supervisor of RDA office in Kaluaggala were informed about the project works and got the clearances for the project. They were made aware of the mitigation project and the funding mechanism. They stated that the mitigation works are appreciable and expressed their willingness to the project.

Mr. B.T.Krishanthi, Grama Niladari Officer of 442 C Illukovita GN Division, 442 F Digana and Ms.G.N.P.W. Galappathi, Grama Niladari Officer of 431 F Weeragolla were informed about the project works and got the clearances for the project. They were made aware of the mitigation project and the funding mechanism. They stated that the mitigation works are appreciable and expressed their willingness to the project.

14. Clearances, no objection, consent, and approvals required for the implementation of the project

Table 11: Clearances, no objection, consent and approvals

Requirement / Approval / Institution	Relevance to the project
14.1 Project implementation	
Approval from the District Secretariat	The approvals will be required and the proposals need to be presented at the District Coordinating Committee, to which chief minister and stakeholder agencies in the district will also participate. The Officer of PMU will present the project, disclose the project details and various concerns including environmental and social issues will be discussed at this meeting. The issues arrived will be addressed in the ESMP, the decisions and recommendations taken up at this meeting will be considered in the ESMP.
Approval from the planning committee	The approval from the planning committee of the Seethawaka Pradeshiya Sabha.
14.2 Approval from the state lands owners relevant to the project	

Central Environmental Authority	Consent from District Central Environmental Authority is required as Colombo District is under the sensitive area under the Soil Conservation Act 25 of 1951.
Department of Forest Department of Wildlife Conservation	As there are no forest reservations and wildlife habitats; Department of Forest and Department of Wildlife Conservation approvals are not needed.
Geological Surveys and Mines Bureau	Approval will be obtained for extraction of materials, transportation and disposal of earth, rocks and mineral debris. (If necessary, only).
Padukka & Seethawaka Divisional Secretariats	Approvals from Padukka & Seethawaka Divisional Secretariats will be obtained for the disposal of waste and plant litter.
Ceylon Electricity Board	Approvals from regional office of Ceylon Electricity Board will be required for power supply for site operation.
National Plant Quarantine Service	Approval from Additional Director National Plant Quarantine Service Katunayake for Director General of Agriculture under the Plant Protect Act No. 35 of 1999 Plant or seed if needed for bio-Project Managed slope mitigation shall be imported into Sri Lanka under the authority and in accordance with the conditions, of a plant importation permit issued.
14.3 Consent/ no objection/ legally bound agreement from the private land ownerships	
Land owner (RDA and Private Landownership)	Signing a legally bound agreement between the land owner and the project implementing authority allowing no-objection to remove the structures, access the land, implement construction works, and engage in long-term maintenance works

The tentative timeline for getting approval is given in the table 8.

Table 12: Tentative timeline for getting approvals

Approvals	Month 1				Month 2			
	W1	W2	W3	W4	W1	W2	W3	W4
Project implementation								
<i>Approval from the District Secretariat</i>								
Submission of application	—							
Project briefing		—						
Respond to comments		—	—	—				
Approvals					—	—		
<i>Approval from planning committee</i>								
Submission of application		—						
Project briefing		—	—					
Respond to comments				—				
Approvals					—	—		
<i>Approval from state land owners RDA</i>								
Submission of application		—						
Respond to comments			—	—				
Approvals					—	—		
Other approvals								
GSMB		—	—					
Ministry of Defense (Depends on the requirement)								
Consent/ no objection from the land ownership	—	—						

15. Grievance redress mechanism for this site

The PMU ES officer is responsible for establishing the grievance redress mechanism for this site for impact communities. (Reference: *Environmental and Social Management Framework for recommended procedure for establishment of grievance redress mechanism*).

16. Information disclosure

It is the responsibility of the PMU to disclose the ES information to following agencies and organizations by indicated modes as a minimum as given in the following table.

Table 13: Proposed scheme of information disclosure

Information	Proposed agencies	Mode of information disclosure
i. Project plan (site details, design, implementation arrangements)	District CEA, District Secretariat, Divisional secretary, RDA, Other district levels Agencies, NBRO district office, AIIB	Meetings, District coordination committee, submission of relevant report to sign agreements, approvals, and consents.
ii. Environmental and Social Management plan	District CEA, AIIB,	Meetings, District Coordination Committee, submission of relevant report to sign agreements, approvals and consents
iii. Monitoring reports (baseline and during construction)	District CEA, AIIB and relevant parties as appropriate	Progress meetings, special meetings, submission of relevant reports
iv. Site inspections for environmental conformance workers health and safety	District CEA, RDA, Divisional secretary, Police, State Land Owners, Grama Niladhari, District Office NBRO, AIIB and relevant parties as appropriate	Written and verbal communications, submission of relevant reports
v. Decisions taken and progress review meetings pertinent to ES matters	District CEA, RDA, Divisional secretary, Police, State Land Owners, Grama Niladhari, District Office NBRO, AIIB and relevant parties as appropriate	Meetings, submission of relevant reports
vi. Grievance redress mechanism	Relevant parties, AIIB	Meetings, written and verbal communications

Table 14: Level of information gathered through consulting institutions

Date	Institution	Person contacted for information
22.07.2025	431 F, Weragolla GN Division Seethawaka AG office	Ms. G. G. P. W Galappaththi (0705793936) Weragolla GN
22.07.2025	Digana and Ilukovita GN Divisions Seethawaka AG office	Ms. B.T krishanthi (0760996573) Digana GN
22.07.2025	RDA Office – Kaluaggala unit	Mr. Upul Kumara (0779094215), Work Supervisor Kaluaggala unit, RDA
22.07.2025	RDA Office – Kaluaggala unit	Mr.K.W.Chandana (0718103531) Labor supervisor Kaluaggala unit, RDA

Annexure I: Images of the site condition and the consultation



Consultation with Digana and Ilukovita Grama Niladhari Ms. B.T krishanthi



Consultation with Ms.G.N.P.W.Galappathi (GN - Weragolla)



Consultation with Work Supervisor and Labor Supervisor, RDA Office, Kaluaggala unit



Consultation with Landowner of the Landslide Location 09

Annexure II: Report on the Stakeholder Consultation: Colombo District

Institution	Name and designation of the contact officer	Concerns raised
Central Environmental Authority	Provincial Director, Central Environmental Authority Central Province.	<ul style="list-style-type: none"> ✓ The Basic Information Questionnaire (BIQ) is needed to fill for the project and submit the application ✓ As the proposed project (mitigation) intends to reduce the risk from landslide for an emergency action CEA approval is not needed considering the priority of the project. ✓ Before project commence a request indicating the mitigation sites need. ✓ If the project is carried out in a sensitive area, even not within a prescribed project, consideration of sensitive area will govern the process.

Road Development Authority	Chief Engineer	<ul style="list-style-type: none"> ✓ This area is under the jurisdiction of Kaluaggalla RDA office ✓ The RDA has no objection and states that mitigation is very much needed. ✓ Other concerns raised <ul style="list-style-type: none"> • A proper handing over of the project is required after the mitigation • RDA will do the maintenance after mitigation • It is emphasized that during the construction the contractor should use Personal Protective Equipment • At all times, the contractor shall provide safe and convenient passage for vehicles, pedestrians, and traffic safety measures, barricades, flagmen, and for the night work, lights and illumination should be provided. ✓ It is also stated that Construction waste/ excavated materials should not be a nuisance to public/commuters
----------------------------	----------------	--

Annexure III: Proposed procedure for obtaining approvals from state land owners and environmental agencies.

1. Proposed procedure by RDA for approval for implementation of landslide mitigation projects in RDA reservation areas

- i. The design to be accepted by the RDA: The project implementing agency should submit detailed design report to RDA with a formal request on nature of approvals required. PMU should prepare above documents and should submit the documents to RDA regional office.
- ii. RDA regional office will evaluate the proposal and may call for project briefing. The PMU should provide necessary briefing as appropriate
- iii. On the approval by RDA an agreement will be signed between RDA and Project implementing agency to access the site, erect structures, and implement mitigation works.
- iv. A condition that would include is
 - A proper handing over of the project is required after the mitigation
 - RDA will do the maintenance after mitigation
 - It is emphasized that during the construction the contractor should use Personal Protective Equipment
 - At all times, the contractor shall provide safe and convenient passage for vehicles, pedestrians, and traffic safety measures, barricades, flagmen and for the night work, lights and illumination should be provided.
 - Construction waste/ excavated materials should not be a nuisance to public/commuters

Annexure IV: Study team

Name	Designation	Position in the study
SAMS Dissanayake	Senior Scientist/ESSD/NBRO	Senior Environmental Scientist
Prabath Liyanaarachchi	Scientist/ ESSD/NBRO	Environmental scientist, GIS/ Demographic data collection /survey, Report preparation
A R Randoomage	Project Assistant	Report Preparation
Malinga Senura	Field Assistant	Data collection

Annexure: List of references

1. Contractor's obligations for Generic Environmental and Social Management Plan- Sri Lanka Landslide Mitigation Project-AIIB
2. Environmental and Social Management Framework-Sri Lanka Landslide Mitigation Project - AIIB
3. Resettlement Planning Framework- Sri Lanka Landslide Mitigation Project -AIIB
4. Felling Trees (Control) Act by Ministry of Agriculture, Rural Economic Affairs, Livestock Development, Irrigation and Fisheries and Aquatic Resources Development
5. Census and Statistical Report (2012), Department of Census and Statistics